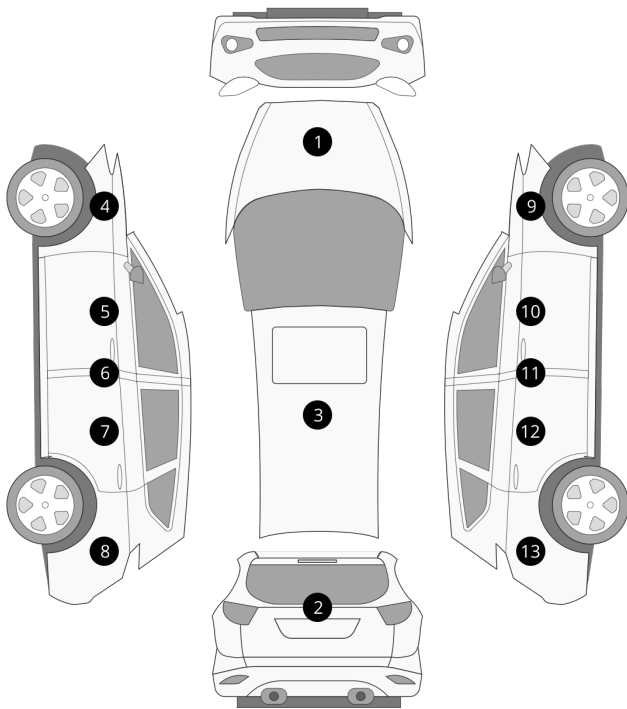


General Information

Date & Time: 23, Oct, 2025 15:54

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	9,556
Registration No.	BAG8059	Chassis No.	PA1B18F37R4278863
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



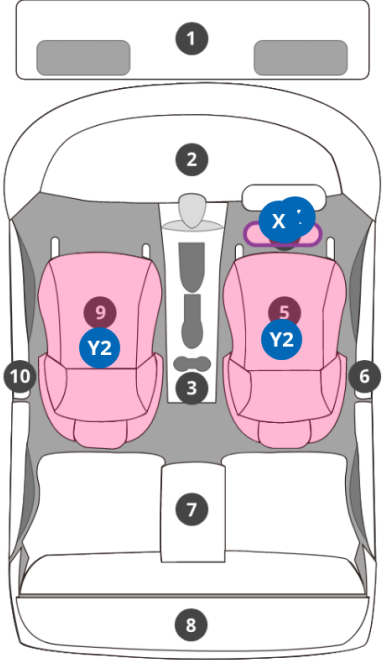
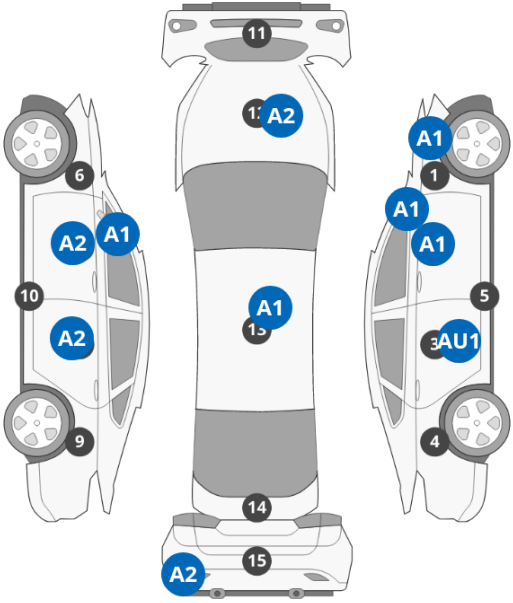
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.6	118	115	129
2	Boot Lid	121.6	117	121	127
3	Roof	103.9	101	96	95/123
4	Left Front Fender	98.3	100	98	97
5	Left Front Door	102.6	101	102	105
6	Center Panel Left				
7	Left Rear Door	109.3	114	108	106
8	Left Back Panel	116.6	123	122	105
9	Right Front Fender	105.6	104	104	109
10	Right Front Door	103.3	108	96	106
11	Center Panel Right				
12	Right Rear Door	105.6	103	105	109
13	Right Back Panel	106.3	104	105	110

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small</p>	<p>Remarks (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with LTO plate, No warranty booklet and Sparetire and Jack and Tools, scratch headlight and tail light, Worn Tires, foul smell, adhesive marks on vehicle.</p>