

General Information

Date & Time: 27, Oct, 2025 16:44

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	36,117
Registration No.	NIJ6171	Chassis No.	PA1B18F31P4205257
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



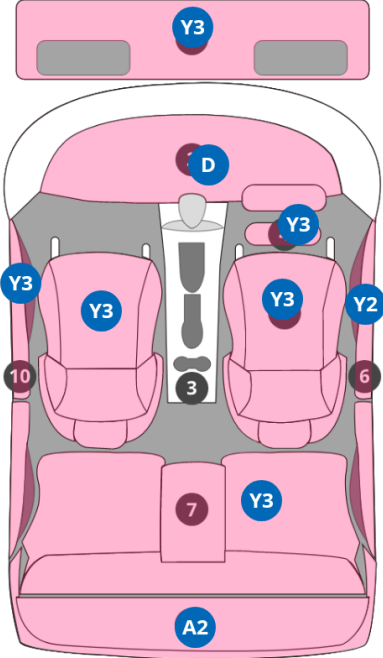
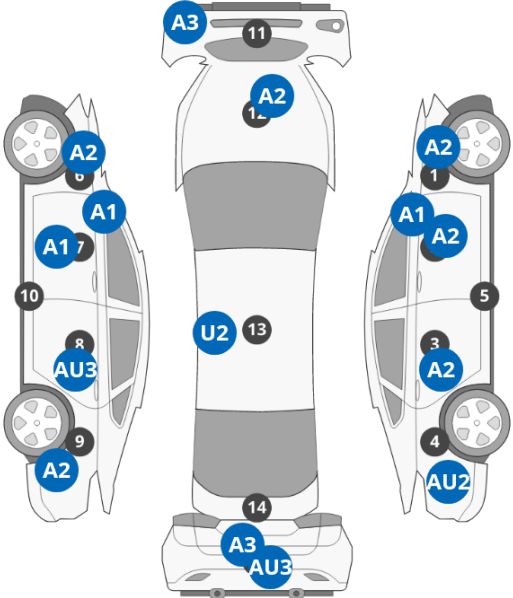
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.3	126	116	122
2	Boot Lid	111.6	112	112	111
3	Roof	106.5	112	119	101/94
4	Left Front Fender	112.0	113	111	112
5	Left Front Door	107.6	109	106	108
6	Center Panel Left				
7	Left Rear Door	104.6	112	102	100
8	Left Back Panel	121.0	135	111	117
9	Right Front Fender	118.6	122	115	119
10	Right Front Door	97.3	91	96	105
11	Center Panel Right				
12	Right Rear Door	98.1	94	97	103
13	Right Back Panel	105.0	97	104	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Medium</p>	<p>Remarks (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Roof - Dent - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No warranty booklets/No jack and No tools/No spare key/No reverse camera/Dome light issue/abnormal engine noise vibration</p>