

General Information

Date & Time: 27, Oct, 2025 15:15

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	50,023
Registration No.	NFR1103	Chassis No.	PA2JA8EM2R0137885
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



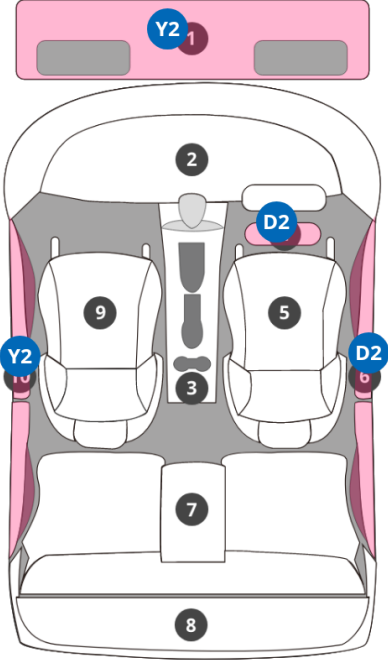
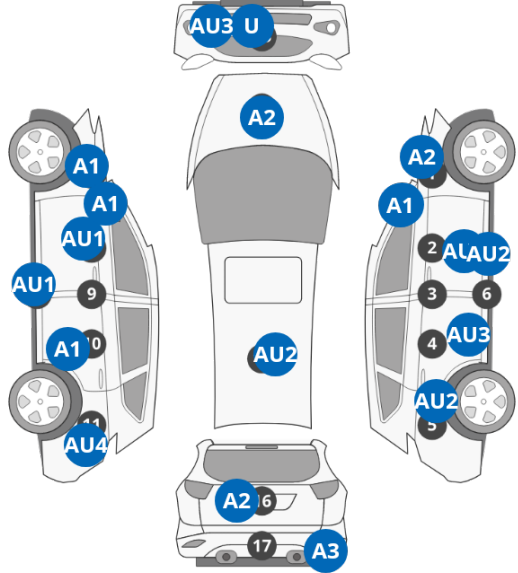
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.6	94	119	89
2	Boot Lid	101.2	100	103	101
3	Roof	95.8	85	98	105/96
4	Left Front Fender	102.0	103	100	103
5	Left Front Door	98.8	100	102	95
6	Center Panel Left				
7	Left Rear Door	100.3	97	98	106
8	Left Back Panel	99.0	98	102	97
9	Right Front Fender	110.3	94	105	132
10	Right Front Door	100.5	96	101	105
11	Center Panel Right				
12	Right Rear Door	103.0	99	111	99
13	Right Back Panel	106.6	107	106	107

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Center Panel - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet, scratch headlight and tail light, Worn Sparetire, No spare key, foul smell.</p>