

General Information

Date & Time: 27, Oct, 2025 14:18

Make	Chevrolet	Model	Trax
YOM	2019	Odo Meter Reading	42,098
Registration No.	NEB1203	Chassis No.	KLBA7684GB737500
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Blue		

Body / Panel Condition



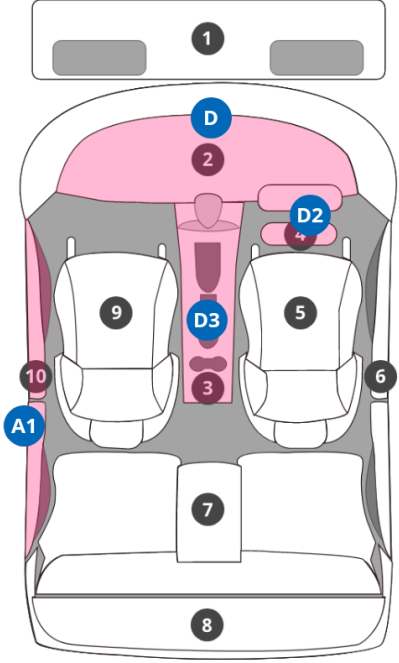
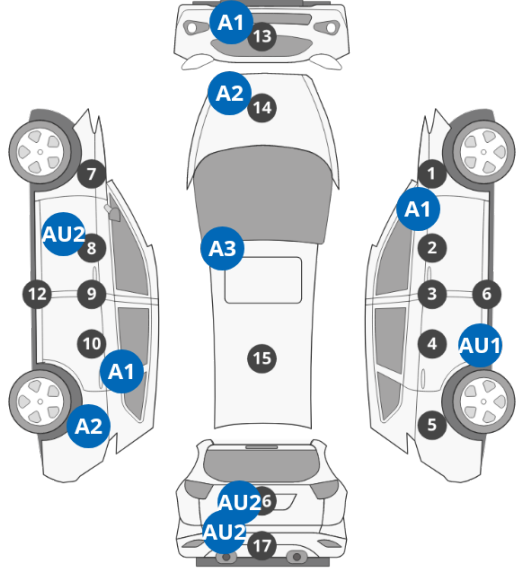
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	130.3	138	132	121
2	Boot Lid	113.0	111	115	113
3	Roof	125.2	123	121	126/131
4	Left Front Fender	128.3	134	128	123
5	Left Front Door	116.3	124	119	106
6	Center Panel Left				
7	Left Rear Door	111.0	108	109	116
8	Left Back Panel	119.0	129	112	116
9	Right Front Fender	130.0	129	129	132
10	Right Front Door	120.3	110	122	129
11	Center Panel Right				
12	Right Rear Door	113.3	117	111	112
13	Right Back Panel	123.3	118	124	128

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Loose, Deformed - Medium / (L) Front Floor Mat - Loose, Deformed - Small / (L) Rear Trim - Cut, Crack - Minimal</p>	<p>Remarks (R) Rear Door, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Medium / (R) Mirror - Scratch, Peeled - Minimal</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Air Conditioner - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate, 1key, no warranty booklet, no jack and tools,scratch headlight, aircon issue.</p>