

General Information

Date & Time: 28, Oct, 2025 13:17

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	43,536
Registration No.	NFR7549	Chassis No.	PA1B18F33R4250722
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



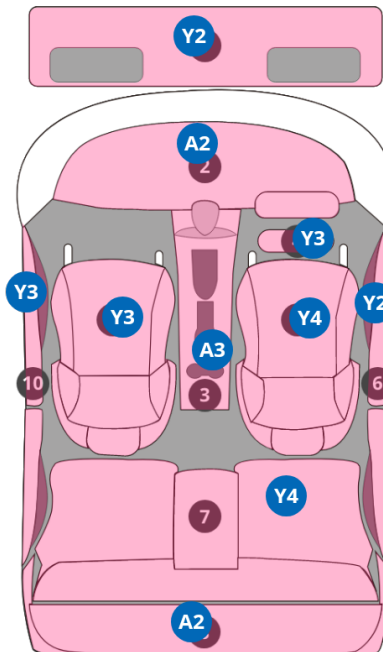
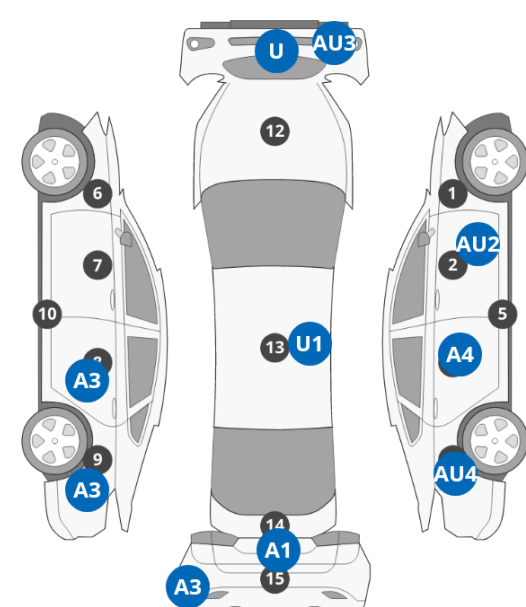
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	265.3	225	316	255
2	Boot Lid	135.6	138	133	136
3	Roof	124.7	137	129	122/111
4	Left Front Fender	132.3	133	133	131
5	Left Front Door	137.0	137	143	131
6	Center Panel Left				
7	Left Rear Door	137.6	141	137	135
8	Left Back Panel	135.0	143	128	134
9	Right Front Fender	143.3	143	148	139
10	Right Front Door	112.3	110	109	118
11	Center Panel Right				
12	Right Rear Door	117.0	111	124	116
13	Right Back Panel	126.3	121	128	130

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Rear Seat - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Roof - Dent - Minimal / Member (Bolted) - Dent - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
with LTO plate/with spare tire/with jack and incomplete tools/with spare key/No warranty booklet/with reverse camera