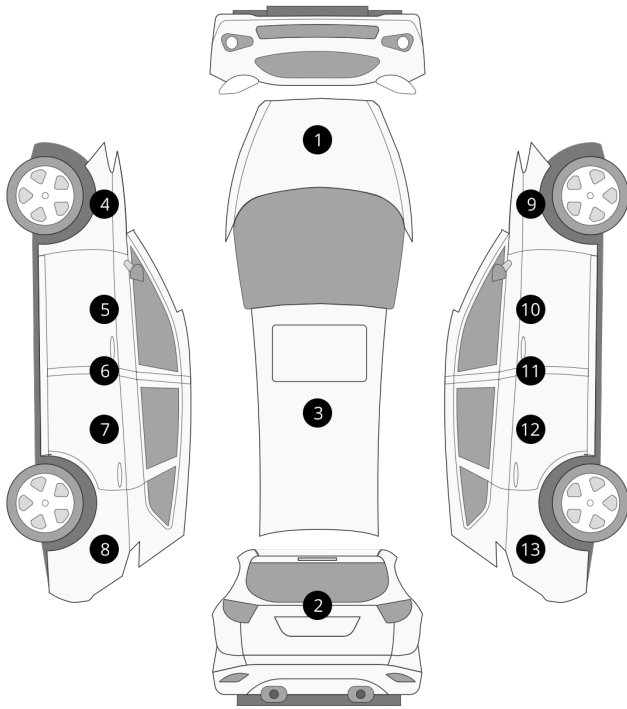


General Information

Date & Time: 27, Oct, 2025 16:13

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	14,977
Registration No.	NKS5172	Chassis No.	MHKAA1BC1PJ011243
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



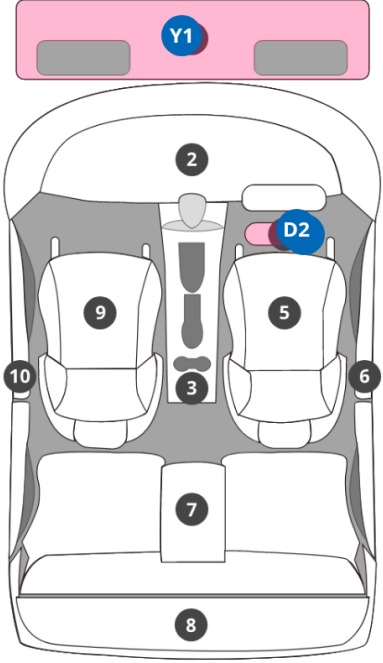
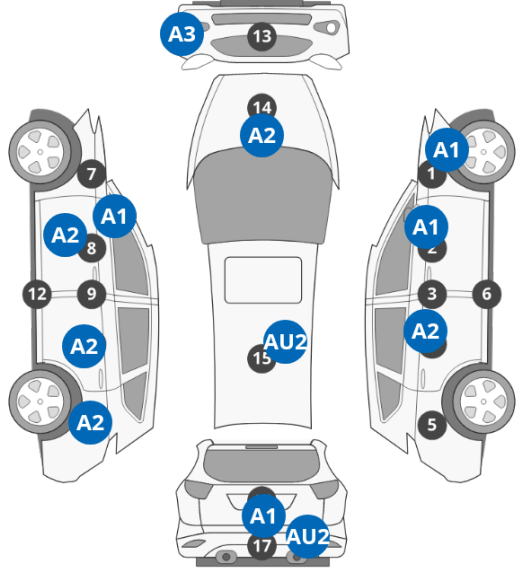
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	125	125	116
2	Boot Lid	85.2	78	93	85
3	Roof	89.5	91	82	90/95
4	Left Front Fender	90.3	102	88	81
5	Left Front Door	106.0	113	101	104
6	Center Panel Left				
7	Left Rear Door	100.0	107	100	93
8	Left Back Panel	94.2	99	90	94
9	Right Front Fender	91.7	96	93	87
10	Right Front Door	104.1	109	105	98
11	Center Panel Right				
12	Right Rear Door	95.0	93	91	102
13	Right Back Panel	82.7	87	77	84

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With spare tire, Jack and incomplete tools, no LTO plate, unusual sound from engine, no spare key, scratch and Crack tail light, scratch headlight,