

General Information

Date & Time: 03, Nov, 2025 13:30

Make	Toyota	Model	Innova
YOM	2020	Odo Meter Reading	97,656
Registration No.	NGL1695	Chassis No.	PA2JA8EM4L0050456
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



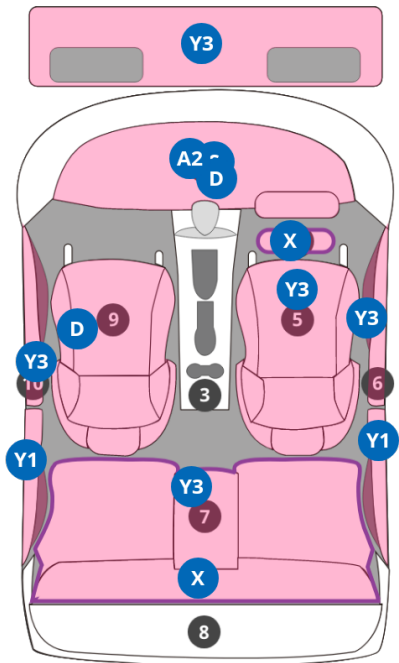
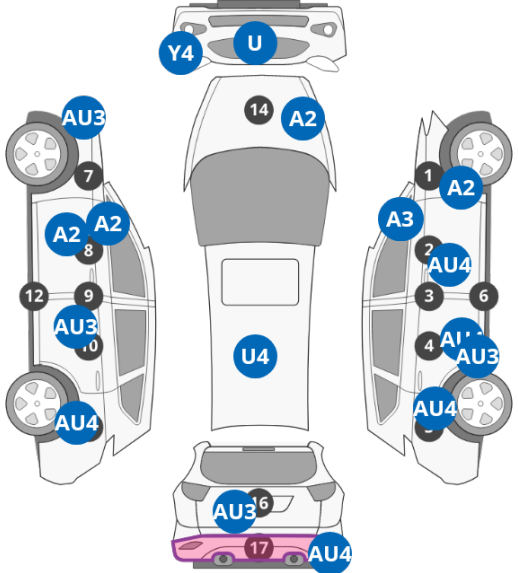
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	154.6	86	123	255
2	Boot Lid	102.1	106	102	98
3	Roof	99.4	97	87	80/134
4	Left Front Fender	96.8	95	96	100
5	Left Front Door	99.1	102	104	91
6	Center Panel Left				
7	Left Rear Door	98.1	95	110	90
8	Left Back Panel	100.6	104	99	99
9	Right Front Fender	157.3	126	168	178
10	Right Front Door	102.3	105	102	100
11	Center Panel Right				
12	Right Rear Door	96.8	90	97	103
13	Right Back Panel	99.4	85	103	110

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Rear Seat Head Rest - Missing - Yes / Rear Seat - Grime - Medium / Mat Other - Missing - Yes / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Medium</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Mirror - Crack - Cracks / (R) Mirror - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Roof - Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, no jack and tools, with spare tire, with LTO plate, possible flooding, scratched and cracked tail light, park light issue, plate light issue, third row seat headrest missing, front emblem missing, right side mirror loose cover/housing</p>