

General Information

Date & Time: 29, Oct, 2025 15:53

Make	Toyota	Model	Raize
YOM	2023	Odo Meter Reading	80,037
Registration No.	EAG2644	Chassis No.	MHKAB1BA9NJ037596
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



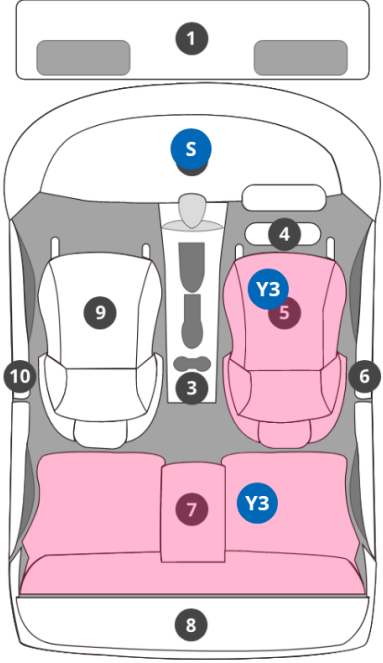
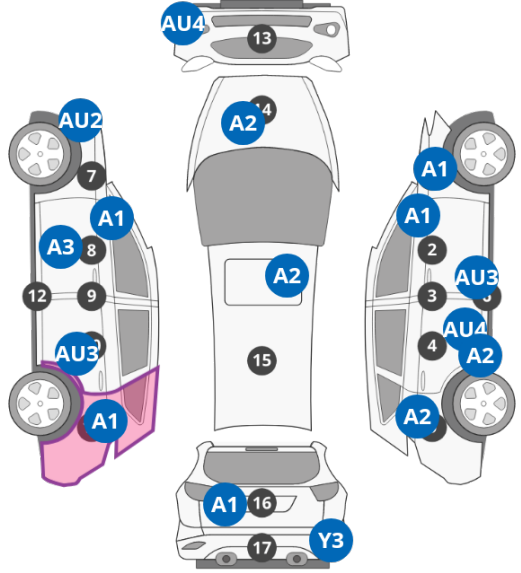
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	88.4	91	95	79
2	Boot Lid	94.6	89	106	89
3	Roof	91.2	103	98	79/86
4	Left Front Fender	91.8	85	105	86
5	Left Front Door	100.0	105	95	100
6	Center Panel Left				
7	Left Rear Door	93.3	95	100	86
8	Left Back Panel	82.4	80	83	84
9	Right Front Fender	97.5	100	100	93
10	Right Front Door	98.2	100	97	98
11	Center Panel Right				
12	Right Rear Door	92.0	97	83	96
13	Right Back Panel	84.7	81	84	90

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Overall Interior - Worn as per age - Yes</p>	<p>Remarks (L) Rear Fender, Molding - Partially Missing - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratches on tail light, possible flooding, abnormal noise and vibration on engine</p>