

General Information

Date & Time: 30, Oct, 2025 15:40

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	31,871
Registration No.	CCC6283	Chassis No.	PA2J8EM8P0133594
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



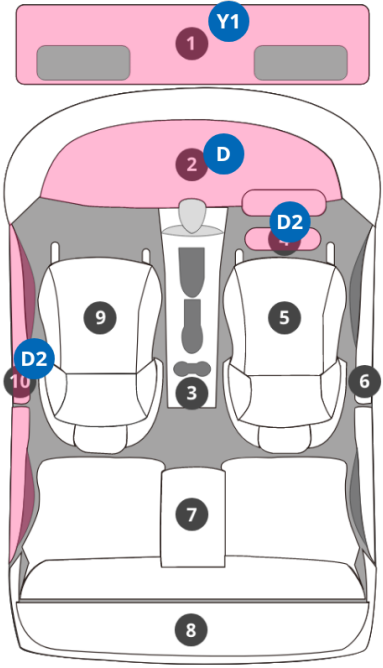
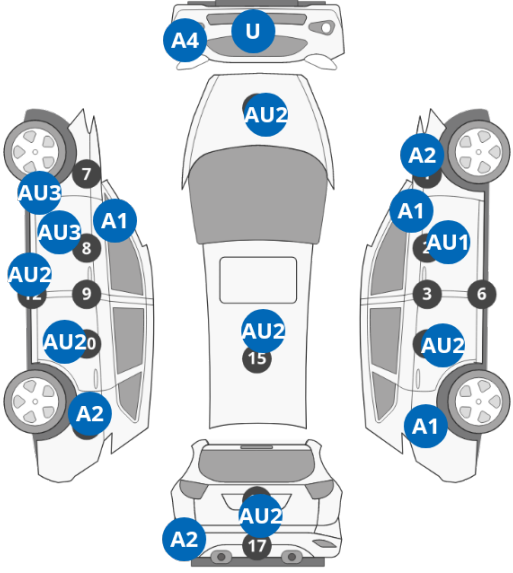
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.0	85	113	90
2	Boot Lid	106.5	108	112	100
3	Roof	115.7	139	95	121/108
4	Left Front Fender	107.3	114	105	103
5	Left Front Door	103.6	103	101	107
6	Center Panel Left				
7	Left Rear Door	109.0	114	107	106
8	Left Back Panel	109.3	113	115	100
9	Right Front Fender	107.0	104	107	110
10	Right Front Door	107.3	102	112	108
11	Center Panel Right				
12	Right Rear Door	104.6	106	100	108
13	Right Back Panel	114.0	111	108	123

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal</p>	<p>Remarks Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, scratch headlight and tail light, no spare key, worn tires and Sparetire.</p>