

General Information

Date & Time: 04, Nov, 2025 10:15

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	29,362
Registration No.	NKA2953	Chassis No.	PA1B18F32R4241851
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



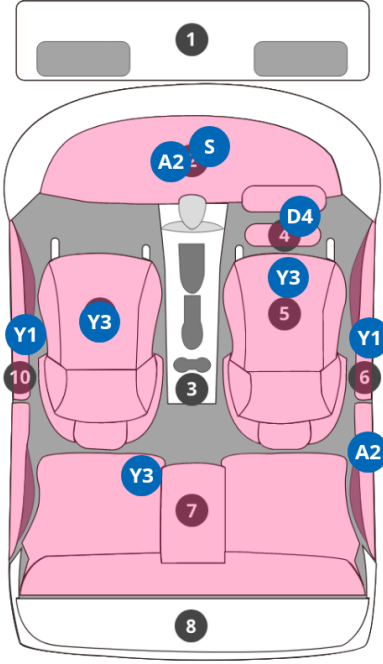
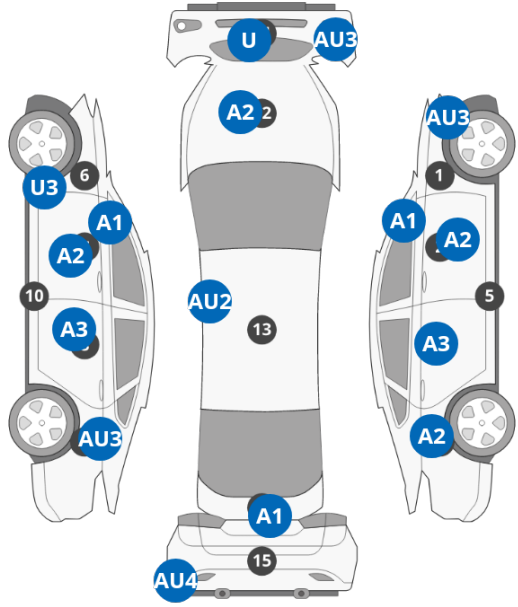
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	109	105	110
2	Boot Lid	105.0	108	101	106
3	Roof	102.1	102	98	98/111
4	Left Front Fender	94.9	88	99	98
5	Left Front Door	101.1	96	97	111
6	Center Panel Left				
7	Left Rear Door	95.9	97	98	93
8	Left Back Panel	104.1	109	104	100
9	Right Front Fender	106.0	111	106	101
10	Right Front Door	104.6	106	105	103
11	Center Panel Right				
12	Right Rear Door	111.6	106	106	123
13	Right Back Panel	104.3	100	108	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Rear Trim - Cut, Crack - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Large / Dashboard - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratched and cracked tail light, brake light issue, possible flooding</p>