

## General Information

Date & Time: 04, Nov, 2025 10:12

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	26,084
<b>Registration No.</b>	DBM9485	<b>Chassis No.</b>	PA1B18F37R4246365
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



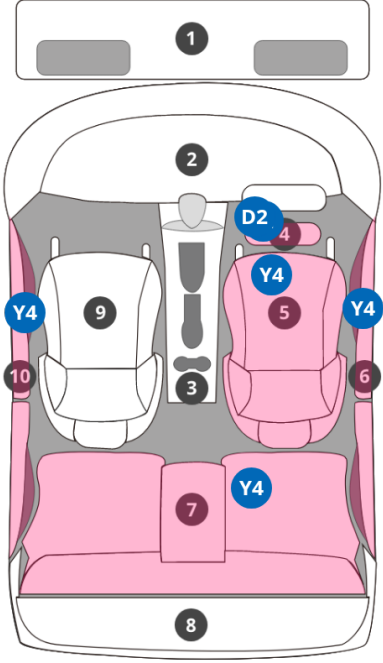
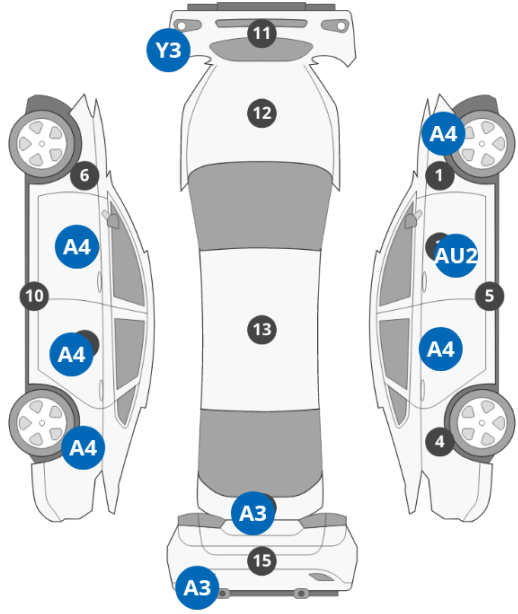
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	115	111	108
2	Boot Lid	102.8	98	101	109
3	Roof	96.3	100	96	95/95
4	Left Front Fender	98.5	100	95	101
5	Left Front Door	102.0	103	100	103
6	Center Panel Left				
7	Left Rear Door	100.6	102	101	99
8	Left Back Panel	102.3	105	101	101
9	Right Front Fender	95.3	100	95	92
10	Right Front Door	102.6	101	104	103
11	Center Panel Right				
12	Right Rear Door	106.7	94	108	118
13	Right Back Panel	101.5	99	98	107

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Large / (L) Front Trim - Grime - Large / Carpet - Worked - Minimal / (L) Front Floor Mat - Worked - Small</p>	<p><b>Remarks</b> (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Crack, Gap - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no tools/ with warranty booklet and LTO plate/ with jack and spare tire /</p>