

General Information

Date & Time: 03, Nov, 2025 15:43

Make	Toyota	Model	Hilux
YOM	2025	Odo Meter Reading	9,337
Registration No.	NKQ9739	Chassis No.	PAHACACA2S6425330
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



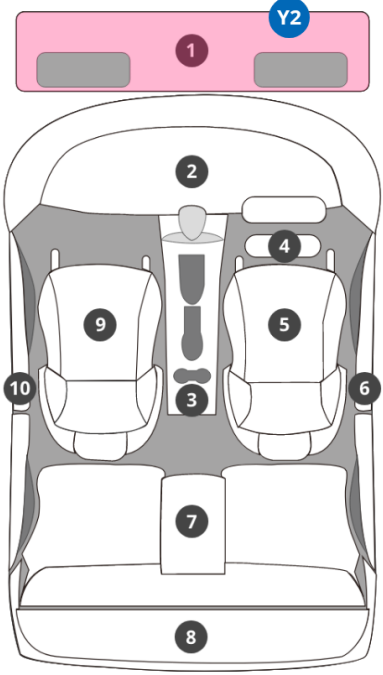
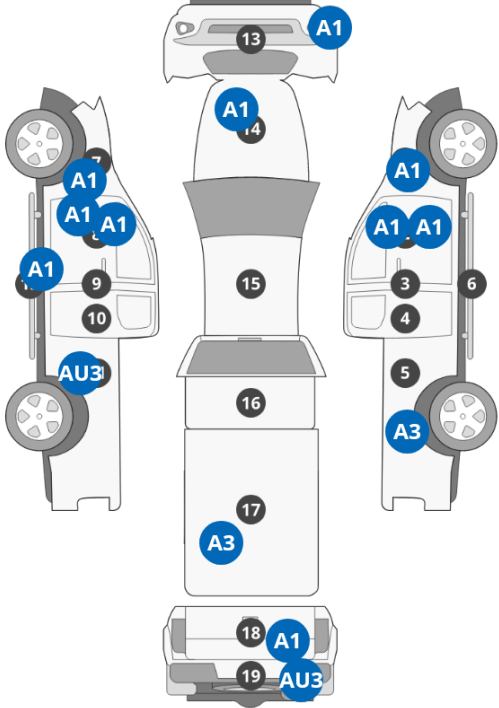
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.3	103	109	110
2	Boot Lid	66.7	57	80	63
3	Roof	112.0	124	115	109/100
4	Left Front Fender	99.7	94	105	100
5	Left Front Door	100.3	98	97	106
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	105.9	67	71	180
9	Right Front Fender	102.4	109	105	93
10	Right Front Door	101.5	97	103	105
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	64.4	60	76	57

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small</p>	<p>Remarks (L) Rear Corner Panel - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Rear Gate - Scratch - Minimal / (L) Side Gate - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Cargo Bed Floor - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>no warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light</p>