

General Information

Date & Time: 12, Nov, 2025 17:21

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	13,909
Registration No.	FAP5645	Chassis No.	PA1B18F3XR4239975
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



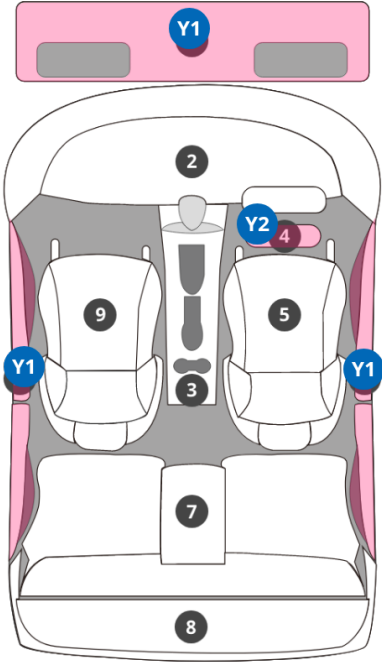
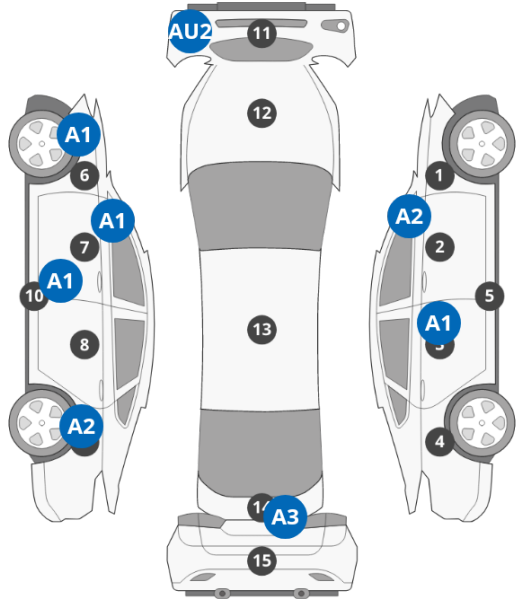
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.1	105	97	113
2	Boot Lid	98.8	100	97	100
3	Roof	91.1	102	85	88/90
4	Left Front Fender	90.7	97	87	88
5	Left Front Door	131.3	131	120	143
6	Center Panel Left				
7	Left Rear Door	163.3	186	164	140
8	Left Back Panel	104.3	107	106	100
9	Right Front Fender	96.5	98	92	100
10	Right Front Door	98.3	103	95	97
11	Center Panel Right				
12	Right Rear Door	104.9	98	104	113
13	Right Back Panel	108.0	111	102	111

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Minimal	Remarks (L) Rear Door - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes

Inspector Notes

With warranty booklet, jack and seat cover. Without spare tire and tools. 3 keys. With LTO plate.