

General Information

Date & Time: 10, Nov, 2025 17:44

Make	Suzuki	Model	Swift
YOM	2016	Odo Meter Reading	88,329
Registration No.	GED9975	Chassis No.	MA3ZC62S6HAA93600
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



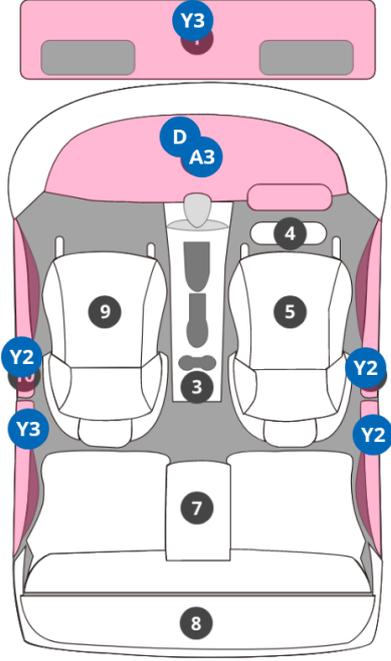
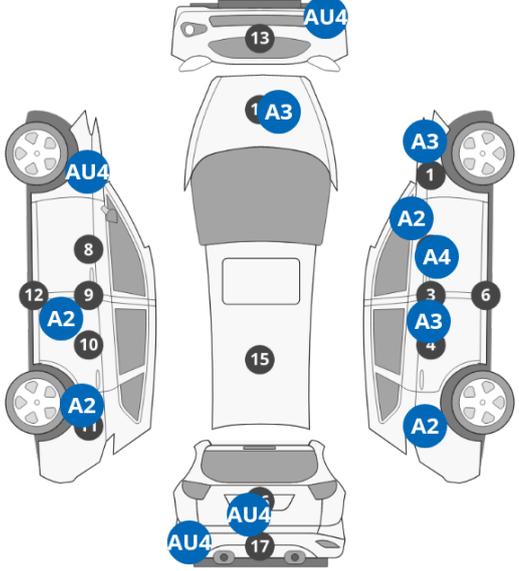
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	89.0	84	96	87
2	Boot Lid	89.5	91	88	90
3	Roof	82.8	86	76	85/84
4	Left Front Fender	94.5	94	95	95
5	Left Front Door	98.7	98	100	98
6	Center Panel Left				
7	Left Rear Door	96.8	99	98	94
8	Left Back Panel	88.2	89	85	91
9	Right Front Fender	79.6	81	84	74
10	Right Front Door	141.6	143	139	143
11	Center Panel Right				
12	Right Rear Door	151.0	142	150	161
13	Right Back Panel	79.6	83	79	77

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Medium / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Small</p>	<p>Remarks (R) Rear Door - Repair Traces - Yes / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Trunk stay issue. Yellow marks at headlight. Scratches at taillight. Without warranty booklet, jack and tools. With spare tire and leather seat cover. 1 key. With LTO plate.</p>