

General Information

Date & Time: 05, Nov, 2025 14:02

Make	Toyota	Model	Hilux
YOM	2025	Odo Meter Reading	12,739
Registration No.	DBQ6723	Chassis No.	MR0JB8DD8R3233051
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Silver		

Body / Panel Condition



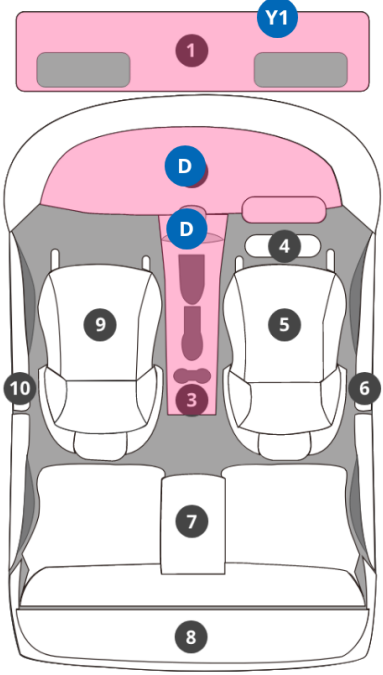
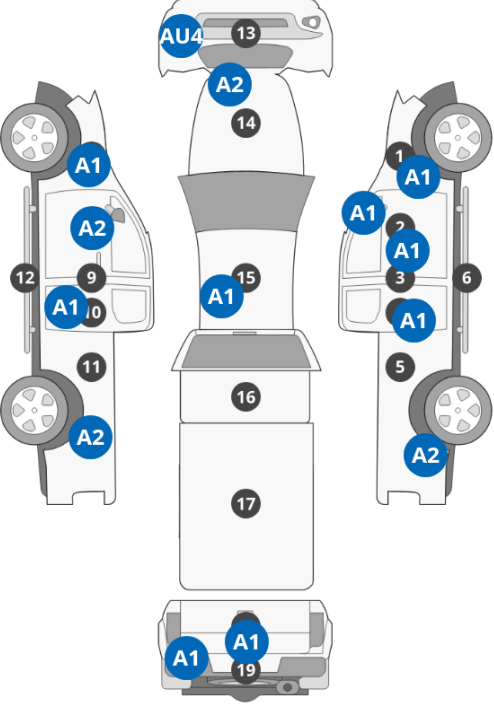
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	83.4	93	80	77
2	Boot Lid	109.6	108	116	105
3	Roof	121.0	121	126	121/116
4	Left Front Fender	106.4	97	113	109
5	Left Front Door	106.0	111	106	101
6	Center Panel Left				
7	Left Rear Door	108.3	104	120	101
8	Left Back Panel	109.0	106	116	105
9	Right Front Fender	104.3	89	89	135
10	Right Front Door	107.6	109	106	108
11	Center Panel Right				
12	Right Rear Door	102.6	103	102	103
13	Right Back Panel	109.3	103	113	112

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Rear Gate - Scratch - Minimal / (L) Side Gate - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, minor scratches on headlight and tail light</p>