

General Information

Date & Time: 07, Nov, 2025 12:47

Make	Toyota	Model	Raize
YOM	2025	Odo Meter Reading	12,959
Registration No.	NOA4556	Chassis No.	MHKAB1BA1SJ117129
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



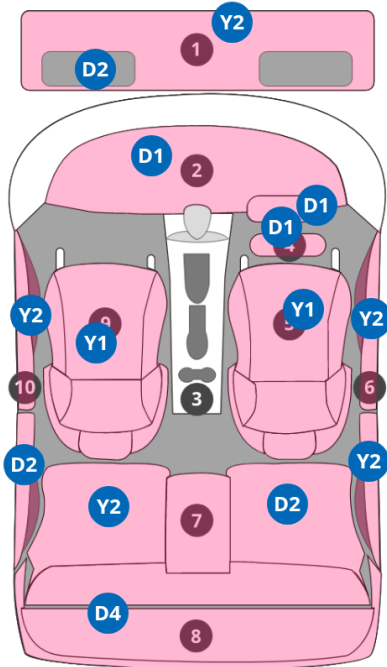
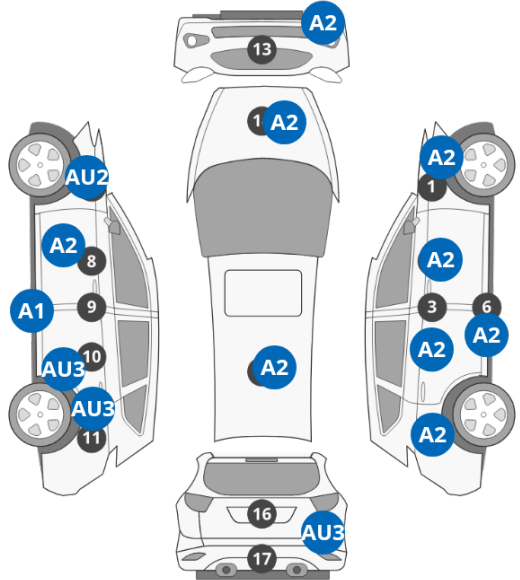
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	88.5	86	91	89
2	Boot Lid	83.6	85	92	74
3	Roof	113.5	106	113	117/118
4	Left Front Fender	93.0	80	101	98
5	Left Front Door	105.0	103	107	105
6	Center Panel Left				
7	Left Rear Door	100.6	101	101	100
8	Left Back Panel	118.4	91	167	97
9	Right Front Fender	104.4	98	103	112
10	Right Front Door	97.7	96	100	97
11	Center Panel Right				
12	Right Rear Door	92.8	93	91	95
13	Right Back Panel	101.6	122	93	90

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Worked - Minimal / Carpet - Worked - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / Rear Seat Head Rest - Worked - Small / Trunk Room - Worked - Large / Sunvisor, Sunglass Holder - Worked - Small / Ceiling - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / (L) Rear Trim - Worked - Small / Glove Box - Worked - Minimal	Remarks (L) Rear Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Center Panel - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

with LTO plate, with spare tire, no tools, taillight scratches, no jack, with spare key, with warranty & manual booklet.