

## General Information

Date & Time: 05, Nov, 2025 16:19

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	39,636
<b>Registration No.</b>	NFR1926	<b>Chassis No.</b>	PA1B18F38R4247024
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



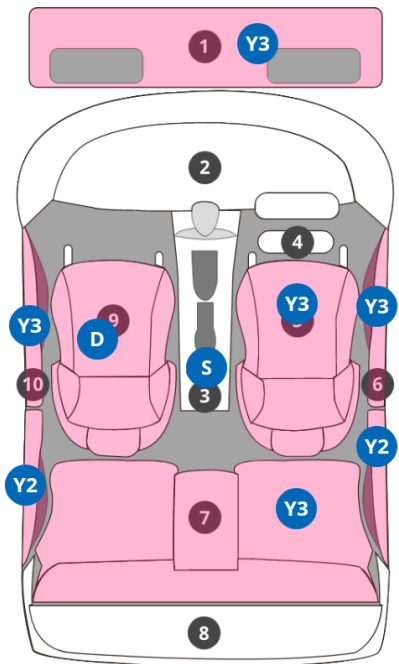
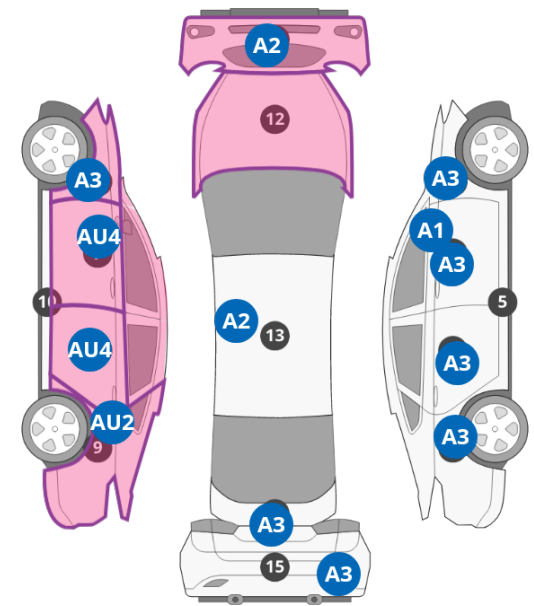
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	118	101	126
2	Boot Lid	323.0	360	294	315
3	Roof	105.2	116	104	100/101
4	Left Front Fender	219.3	223	268	167
5	Left Front Door	117.6	104	114	135
6	Center Panel Left				
7	Left Rear Door	107.0	107	109	105
8	Left Back Panel	199.3	191	154	253
9	Right Front Fender	130.6	174	105	113
10	Right Front Door	117.0	114	115	122
11	Center Panel Right				
12	Right Rear Door	128.0	115	124	145
13	Right Back Panel	131.3	137	124	133

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a :</b> Cut, Fray <b>d :</b> Loose, Deformed <b>k :</b> Animal Hair <b>s :</b> Smell <b>t :</b> Cigarette Burns <b>x :</b> Defective <b>y :</b> Stain</p>	 <p><b>A :</b> Scratch <b>AU :</b> Scratch &amp; Dent <b>B :</b> Modified <b>C :</b> Corrosion <b>G :</b> Stone chip <b>P :</b> Faded <b>S :</b> Rust <b>SC :</b> Rust &amp; Corrosion <b>U :</b> Dent <b>X :</b> Defective <b>Y :</b> Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Medium / (L) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Seat - Worn - Yes / Overall Interior - Smell - Yes</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Repair mark - Difference in Color / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Medium / (L) Front Fender, Molding - Repair mark - Yes / Roof - Scratch - Small / Overall Exterior - Faded(Color, Gloss) - Yes / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Right Front Pillar - Condition of Welding ? - Yes / Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with jack, no tools, no manual &amp; warranty booklet, taillight scratches, no spare tires, with LTO apprehension MMDA Violation, with LTO plate, with back camera</p>