

General Information

Date & Time: 05, Nov, 2025 14:28

Make	Toyota	Model	Hiace
YOM	2024	Odo Meter Reading	108,329
Registration No.	NHG5834	Chassis No.	JTFJT02P6P5035541
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



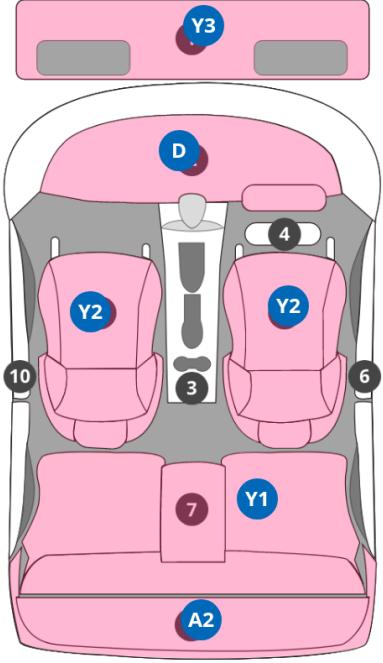
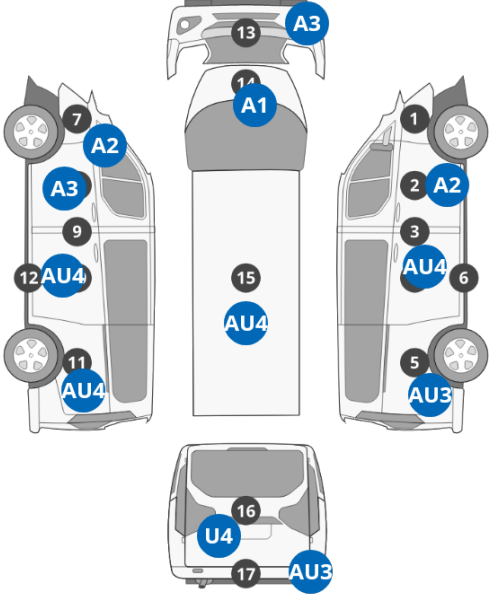
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	90.3	100	93	78
2	Boot Lid	74.1	75	79	68
3	Roof	78.1	82	86	69/76
4	Left Front Fender	91.8	103	84	89
5	Left Front Door	67.7	75	62	67
6	Center Panel Left	84.3	82	97	75
7	Left Rear Door	68.0	66	71	67
8	Left Back Panel	253.1	621	70	68
9	Right Front Fender	90.6	90	85	97
10	Right Front Door	68.9	67	73	68
11	Center Panel Right	71.8	86	66	64
12	Right Rear Door	69.9	73	73	64
13	Right Back Panel	77.2	80	77	75

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Medium</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / Front Panel - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / Roof - Scratch & Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/reverse camera not working/with jack and incomplete tools/with warranty booklet/No spare key/dome light issue/No fog light</p>