

General Information

Date & Time: 08, Nov, 2025 15:14

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	112,545
Registration No.	NHJ5410	Chassis No.	PA1B18F38P4216191
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



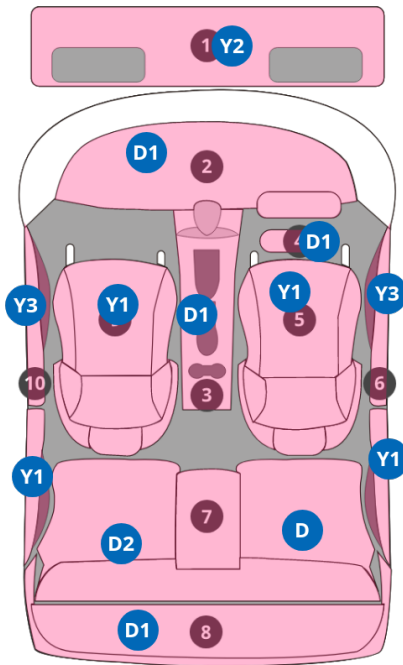
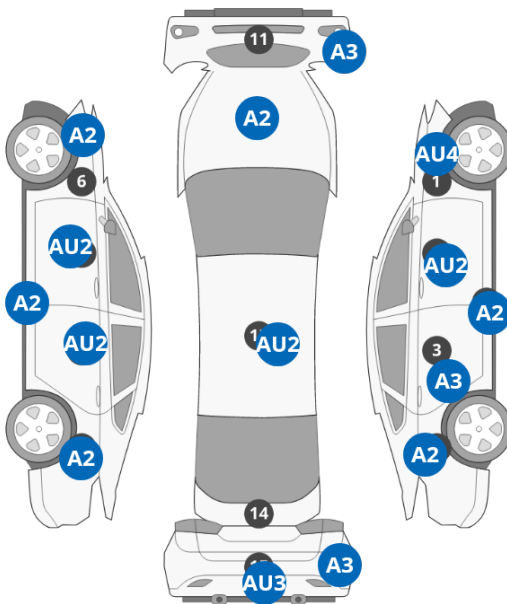
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	130.0	126	156	108
2	Boot Lid	118.3	117	115	123
3	Roof	121.2	112	114	149/110
4	Left Front Fender	104.3	95	102	116
5	Left Front Door	104.4	99	103	111
6	Center Panel Left				
7	Left Rear Door	117.3	132	115	105
8	Left Back Panel	117.0	120	116	115
9	Right Front Fender	111.3	106	106	122
10	Right Front Door	110.3	109	117	105
11	Center Panel Right				
12	Right Rear Door	115.3	109	117	120
13	Right Back Panel	117.3	112	127	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dash-board - Worked - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Minimal / Rear Seat Head Rest - Worked - Small / Trunk Room - Worked - Minimal / Console, Switchs, Vents - Worked - Minimal / (R) Rear Trim - Grime - Minimal / Carpet - Worked - Minimal / (R) Front Trim - Grime - Medium / Ceiling - Grime - Small / Rear Seat - Worn - Yes	Remarks Bonnet, Headlight - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Medium / Roof - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

with owner's manual & warranty booklet, scratches on Taillight, issue on plate light, with back camera, with spare tire, no tools