

General Information

Date & Time: 07, Nov, 2025 11:06

Make	Toyota	Model	Rush
YOM	2023	Odo Meter Reading	129,836
Registration No.	NHI5393	Chassis No.	MHKE8FF3PPK053239
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



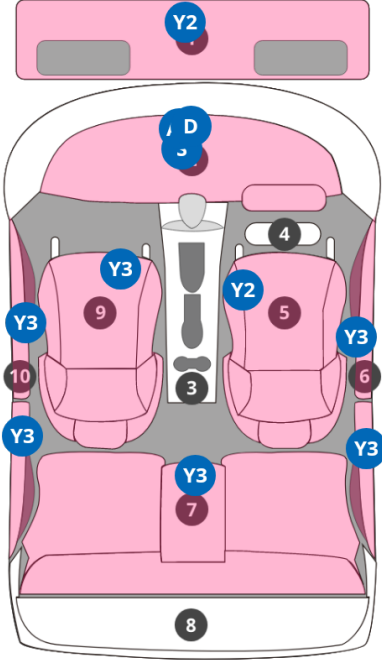
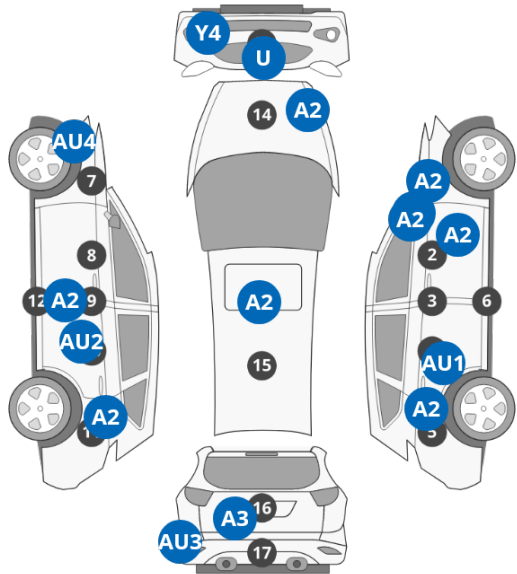
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.4	113	96	95
2	Boot Lid	114.6	111	119	114
3	Roof	94.9	82	95	100/103
4	Left Front Fender	129.1	116	93	178
5	Left Front Door	100.6	98	96	108
6	Center Panel Left				
7	Left Rear Door	98.6	102	94	100
8	Left Back Panel	99.2	105	94	99
9	Right Front Fender	101.7	109	103	93
10	Right Front Door	110.0	108	97	125
11	Center Panel Right				
12	Right Rear Door	104.4	106	97	110
13	Right Back Panel	104.1	110	100	103

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small / (R) Rear Trim - Grime - Medium / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Medium / Overall Interior - Smell - Yes / Dashboard - Traces of Adhesive Tape - Yes	Remarks (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / Overall Exterior - Worn as per age - Yes / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small / Member (Bolted) - Dent - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, plate light issue