

General Information

Date & Time: 24, Nov, 2025 15:32

Make	Toyota	Model	Hiace
YOM	2020	Odo Meter Reading	58,182
Registration No.	CAV2651	Chassis No.	JTFJT02P0K5023376
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



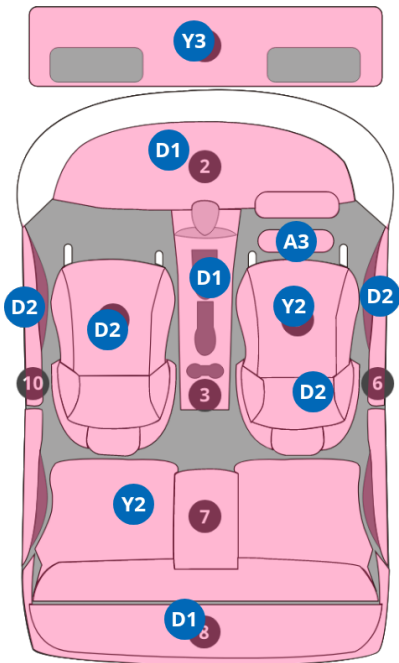
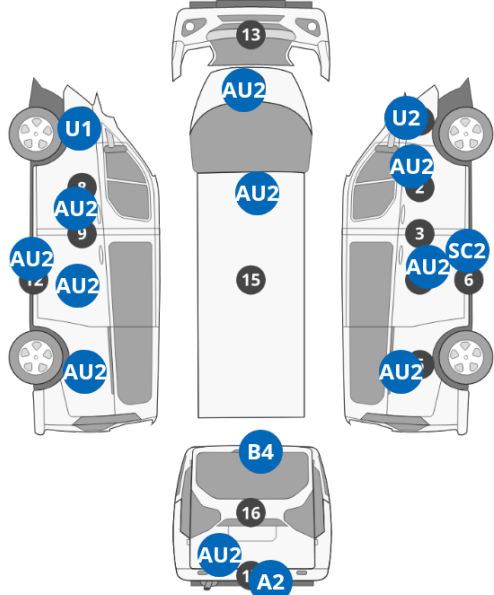
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	81.8	85	84	76
2	Boot Lid	167.5	63	74	365
3	Roof	75.3	59	76	85/81
4	Left Front Fender	73.0	80	73	67
5	Left Front Door	74.2	63	69	91
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	74.4	75	59	89
9	Right Front Fender	81.5	83	82	79
10	Right Front Door	66.0	71	62	65
11	Center Panel Right	69.3	76	69	63
12	Right Rear Door	71.6	72	71	72
13	Right Back Panel	69.9	73	66	71

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Trim - Worked - Small / Rear Seat - Grime - Small / Trunk Room - Worked - Minimal / (R) Front Seat - Grime - Small / Dashboard - Worked - Minimal / Console, Switches, Vents - Worked - Minimal / Ceiling - Grime - Medium / (L) Front Seat Head Rest - Worked - Small / (R) Front Seat Head Rest - Worked - Small / (R) Front Trim - Worked - Small</p>	<p>Remarks (R) Step - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Dent - Minimal / (R) Front Fender, Molding - Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Trunk Hood, Rear Gate - Modified - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Rust, Corrosion - Small / Rear Bumper, Lamps, Panels - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare key, no warranty & manual booklet, no spare tire & tools, no reverse camera, radio unit issue, foglamp issue, signal light front issue, map/dome light issue, dashboard modified, engine modified, rear trunk interior issue, passenger side slide handle door issue, scratches on taillight.</p>