

General Information

Date & Time: 07, Nov, 2025 10:41

Make	Mitsubishi	Model	Mirage
YOM	2019	Odo Meter Reading	60,823
Registration No.	NDJ1791	Chassis No.	PAEA13TXKKA006932
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



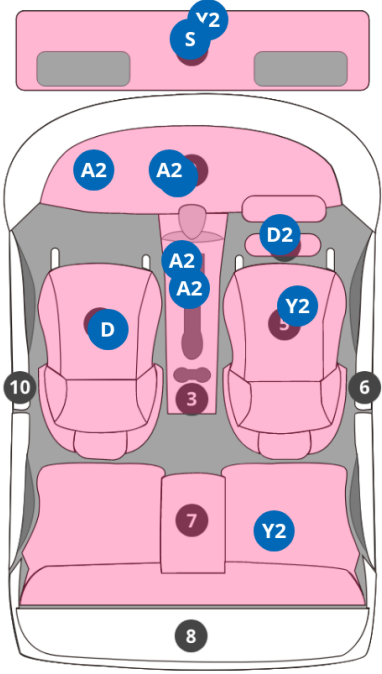
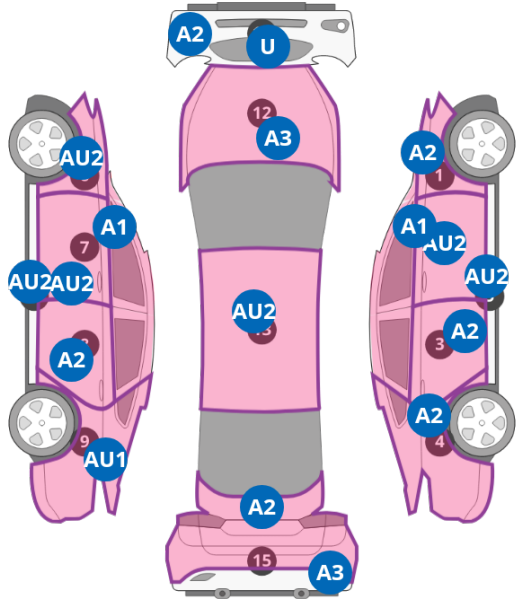
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	275.0	271	308	246
2	Boot Lid	255.3	196	248	322
3	Roof	131.6	139	97	194/97
4	Left Front Fender	805.3	917	880	619
5	Left Front Door	180.6	262	100	180
6	Center Panel Left				
7	Left Rear Door	472.3	252	597	568
8	Left Back Panel	232.0	269	265	162
9	Right Front Fender	792.6	868	824	686
10	Right Front Door	201.0	110	254	239
11	Center Panel Right				
12	Right Rear Door	292.6	349	275	254
13	Right Back Panel	406.3	226	245	748

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Knobs - Worn, Peel, Crack - Small / Room Mirror - Stuck - Yes / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Roof - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Member (Bolted) - Dent - Yes / Roof - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : C	Functional Evaluation : D
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Audio, Radio - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate and Spare tire, No Tools and Jack and Warranty booklet, No spare key, Abnormal vibration on engine And Abnormal noise when starting, scratch headlight and tail light crack, worn tires, foul smell, adhesive marks on vehicle.