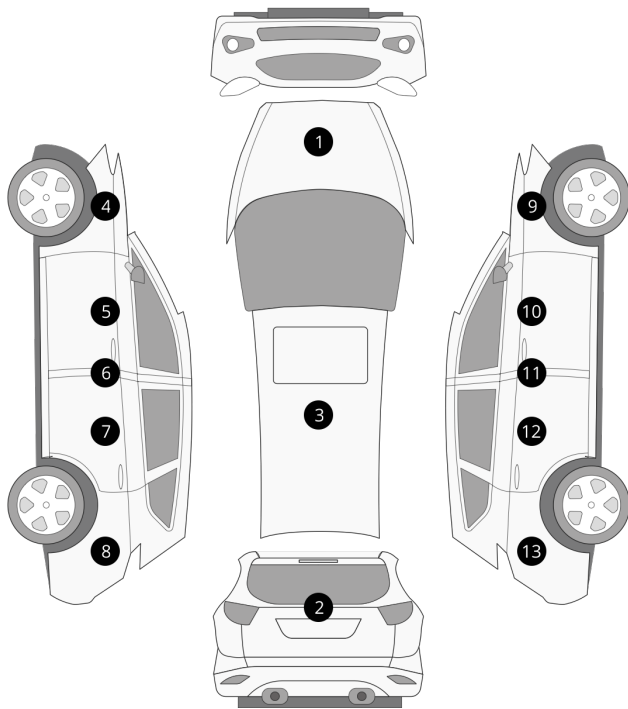


General Information

Date & Time: 07, Nov, 2025 10:40

Make	Mitsubishi	Model	Mirage
YOM	2023	Odo Meter Reading	31,874
Registration No.	NFA1061	Chassis No.	PAEA13RXPPA015317
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



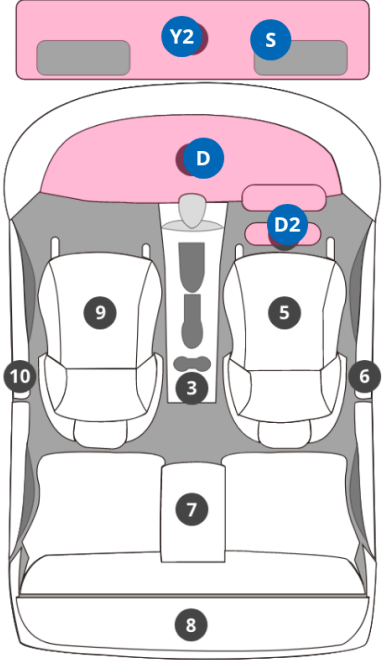
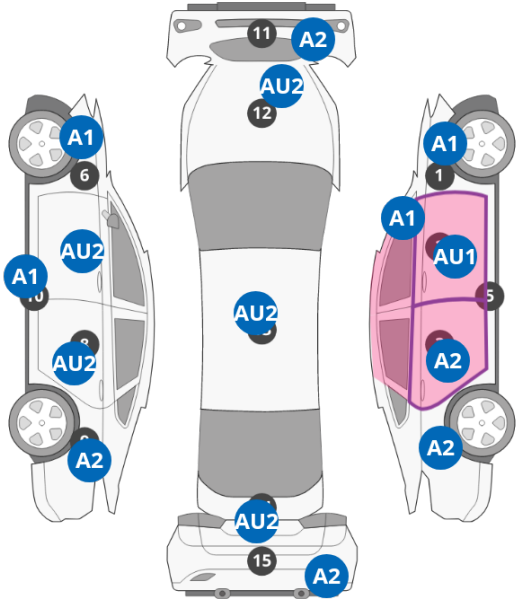
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.3	130	113	130
2	Boot Lid	111.0	110	113	110
3	Roof	105.5	108	102	101/111
4	Left Front Fender	113.0	114	113	112
5	Left Front Door	107.6	108	107	108
6	Center Panel Left				
7	Left Rear Door	104.3	105	100	108
8	Left Back Panel	122.3	121	122	124
9	Right Front Fender	110.6	105	107	120
10	Right Front Door	112.6	115	108	115
11	Center Panel Right				
12	Right Rear Door	107.3	105	105	112
13	Right Back Panel	118.3	119	116	120

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes	Remarks (R) Rear Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With LTO plate and Sparetire and Jack, No Tools and warranty booklet, scratch headlight and tail light, Worn Tires and Sparetire, foul smell.