

General Information

Date & Time: 17, Dec, 2025 20:13

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	13,534
Registration No.	GBK1511	Chassis No.	PA1B18F32S4287508
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



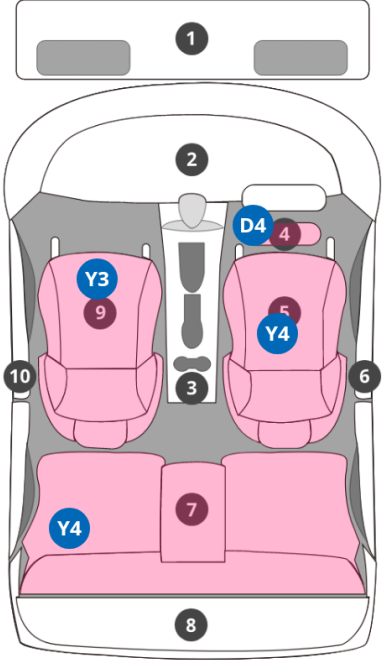
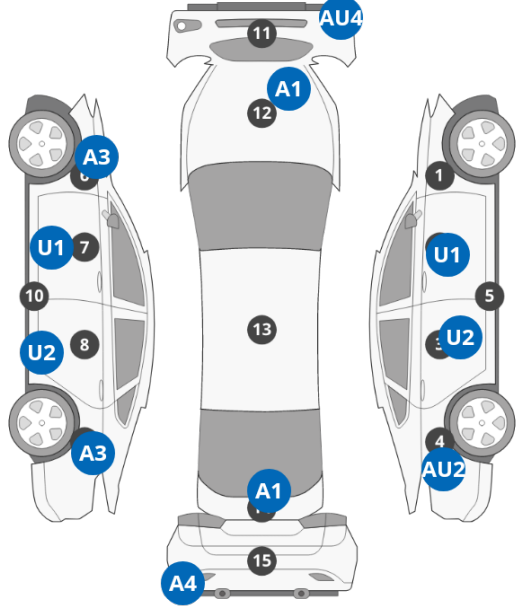
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.7	117	108	98
2	Boot Lid	104.3	101	102	110
3	Roof	100.2	103	102	91/105
4	Left Front Fender	94.7	94	97	93
5	Left Front Door	96.8	98	97	96
6	Center Panel Left				
7	Left Rear Door	104.0	106	103	103
8	Left Back Panel	107.6	106	113	104
9	Right Front Fender	99.0	104	93	100
10	Right Front Door	106.0	106	110	102
11	Center Panel Right				
12	Right Rear Door	109.6	113	109	107
13	Right Back Panel	119.0	108	113	136

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Large / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (R) Front Seat - Grime - Large</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Rear Door, Molding - Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Dent - Small / Bonnet, Headlight - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Front Door, Molding - Dent - Minimal / (R) Front Door, Molding - Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>no LTO plate/ no warranty booklet/ with jack and spare tire/ with tools/</p>