

General Information

Date & Time: 03, Dec, 2025 19:51

Make	Toyota	Model	Hilux
YOM	2024	Odo Meter Reading	78,568
Registration No.	FAQ4962	Chassis No.	MR0JB8DD4P3548474
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Black		

Body / Panel Condition



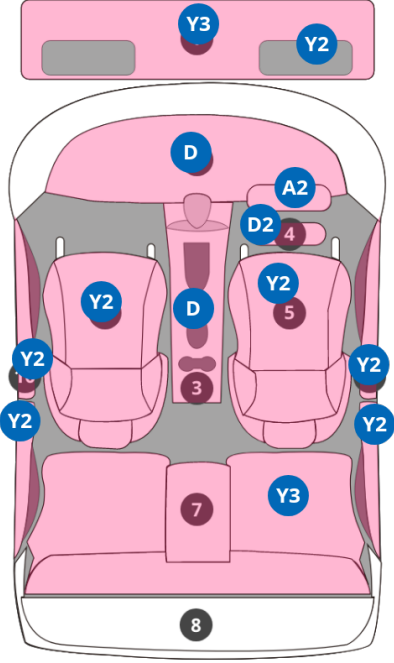
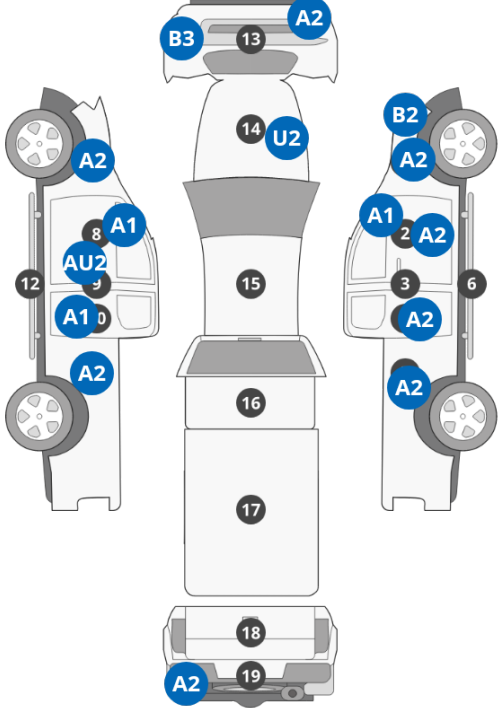
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.0	131	130	132
2	Boot Lid	108.3	111	106	108
3	Roof	131.5	119	122	155/130
4	Left Front Fender	115.3	115	118	113
5	Left Front Door	123.0	122	122	125
6	Center Panel Left				
7	Left Rear Door	112.6	118	113	107
8	Left Back Panel	126.6	116	135	129
9	Right Front Fender	109.0	107	114	106
10	Right Front Door	116.3	124	119	106
11	Center Panel Right				
12	Right Rear Door	108.3	101	106	118
13	Right Back Panel	118.0	126	115	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Small / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small</p>	<p>Remarks (L) Side Gate - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Modified - Medium / (R) Front Fender, Molding - Modified - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Side Gate - Scratch - Small / Bonnet, Headlight - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Crack at front bumper. With warranty booklet and spare tire. Without jack, tools and seat cover. 1 key. With LTO plate.</p>