

General Information

Date & Time: 19, Nov, 2025 19:15

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	32,346
Registration No.	FAR7039	Chassis No.	MHKAA1BC8RJ018595
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



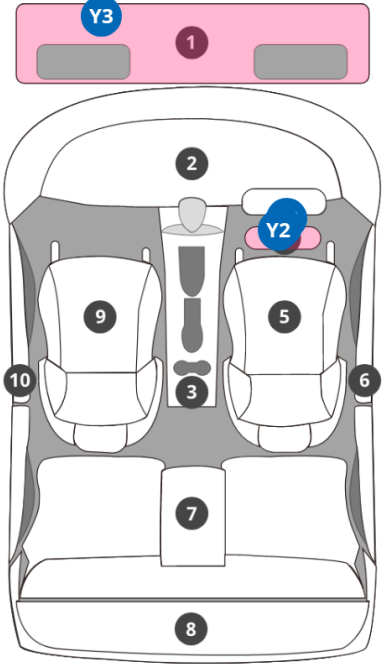
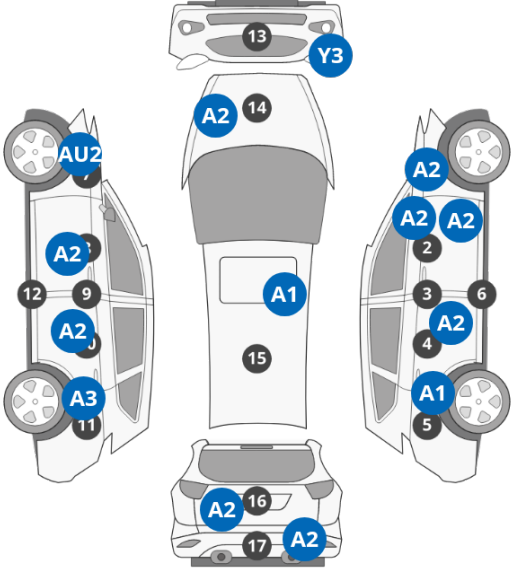
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	119	114	109
2	Boot Lid	87.4	79	98	86
3	Roof	81.2	80	83	86/75
4	Left Front Fender	101.8	100	105	101
5	Left Front Door	108.9	99	114	114
6	Center Panel Left				
7	Left Rear Door	103.2	113	107	90
8	Left Back Panel	98.8	92	109	96
9	Right Front Fender	86.2	80	89	90
10	Right Front Door	111.0	132	104	97
11	Center Panel Right				
12	Right Rear Door	103.3	99	100	111
13	Right Back Panel	91.8	93	84	99

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Medium</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light</p>