

General Information

Date & Time: 17, Nov, 2025 18:56

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	24,283
Registration No.	FAR8285	Chassis No.	PA1B18F31R4255210
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



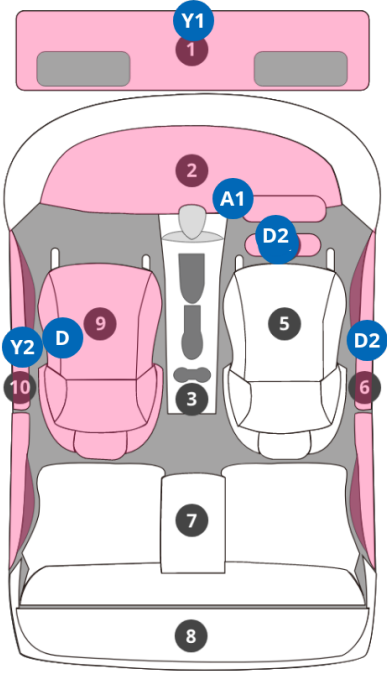
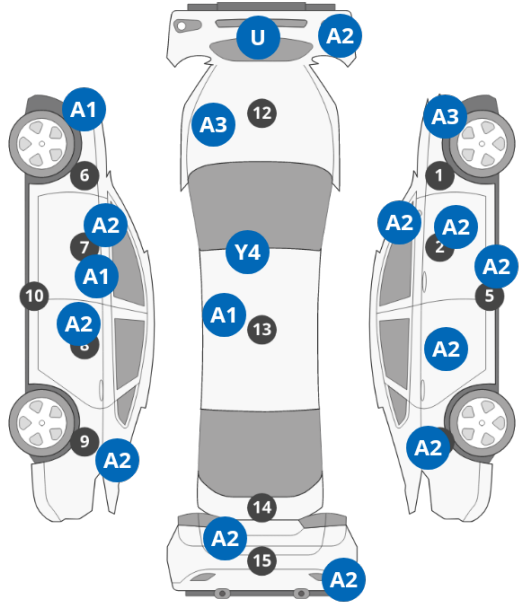
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.6	125	128	124
2	Boot Lid	119.6	126	116	117
3	Roof	112.5	111	104	117/118
4	Left Front Fender	108.2	99	112	114
5	Left Front Door	175.3	172	186	168
6	Center Panel Left				
7	Left Rear Door	118.6	134	113	109
8	Left Back Panel	121.3	126	115	123
9	Right Front Fender	113.0	112	111	116
10	Right Front Door	108.3	112	104	109
11	Center Panel Right				
12	Right Rear Door	114.0	109	112	121
13	Right Back Panel	120.6	123	114	125

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Trim - Worked - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Worn - Yes / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal	Remarks (L) Front Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Windshield - Damaged - Large / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light,