

General Information

Date & Time: 20, Nov, 2025 19:55

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	5,942
Registration No.	FAS5512	Chassis No.	PA1B18F34R4280540
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



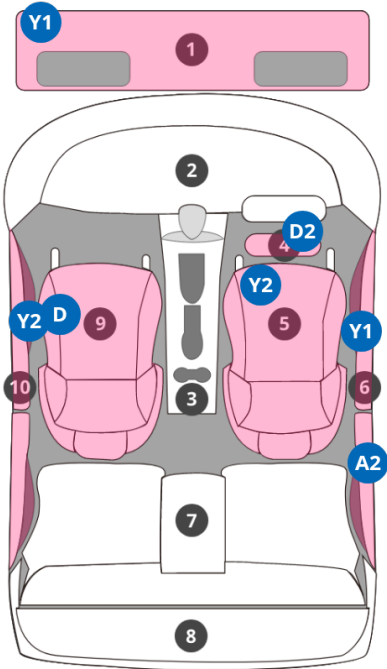
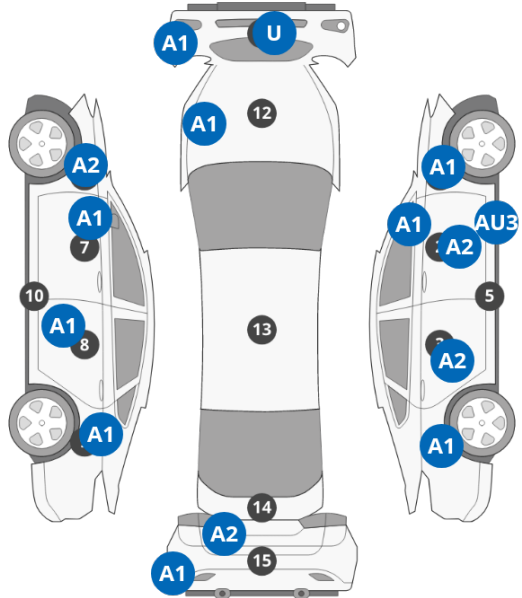
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	113	106	107
2	Boot Lid	105.4	99	100	118
3	Roof	97.7	103	99	89/100
4	Left Front Fender	98.1	99	100	95
5	Left Front Door	95.6	97	96	94
6	Center Panel Left				
7	Left Rear Door	101.5	102	105	98
8	Left Back Panel	108.7	126	106	94
9	Right Front Fender	102.6	101	102	105
10	Right Front Door	99.4	106	96	96
11	Center Panel Right				
12	Right Rear Door	107.8	100	103	121
13	Right Back Panel	103.0	101	103	105

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Ceiling - Grime - Minimal / (R) Rear Trim - Cut, Crack - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light