

General Information

Date & Time: 19, Nov, 2025 19:15

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	10,350
Registration No.	FAQ9295	Chassis No.	PA1B18F36R4269541
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



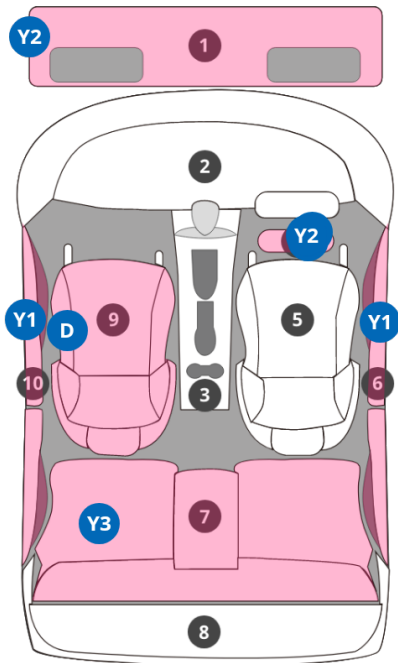
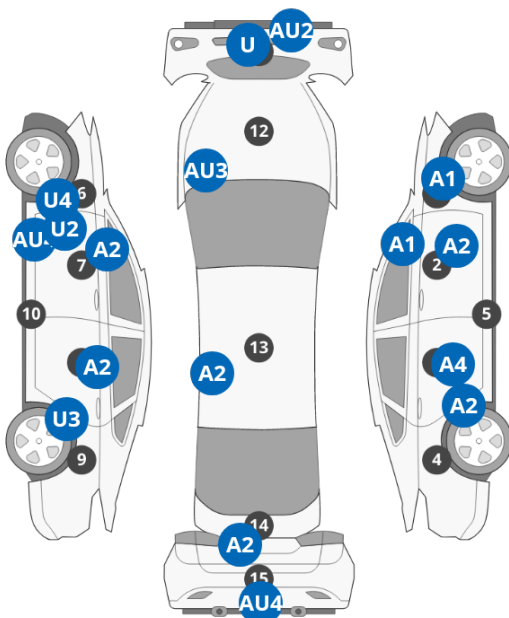
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.6	114	123	125
2	Boot Lid	111.3	113	109	112
3	Roof	124.7	108	109	170/112
4	Left Front Fender	101.2	102	100	102
5	Left Front Door	100.7	100	99	103
6	Center Panel Left				
7	Left Rear Door	109.3	114	105	109
8	Left Back Panel	121.0	128	118	117
9	Right Front Fender	103.0	104	98	107
10	Right Front Door	105.3	111	100	105
11	Center Panel Right				
12	Right Rear Door	107.0	107	105	109
13	Right Back Panel	118.3	127	122	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / Ceiling - Grime - Small / Mat Other - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Door, Molding - Dent - Small / (L) Front Fender, Molding - Dent - Large / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Medium / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, cheek light loose