

General Information

Date & Time: 19, Nov, 2025 19:24

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	8,751
Registration No.	GBK1332	Chassis No.	MHKAA1BC7SJ037922
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



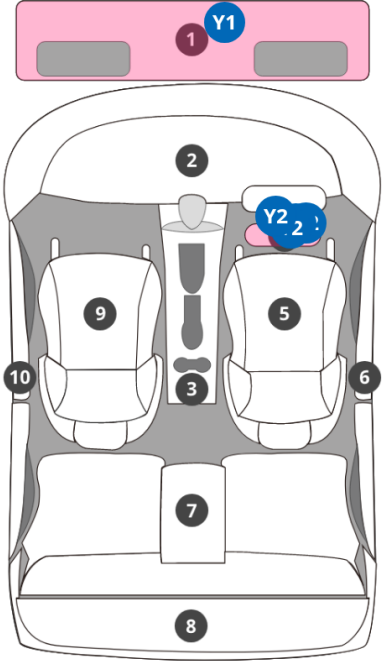
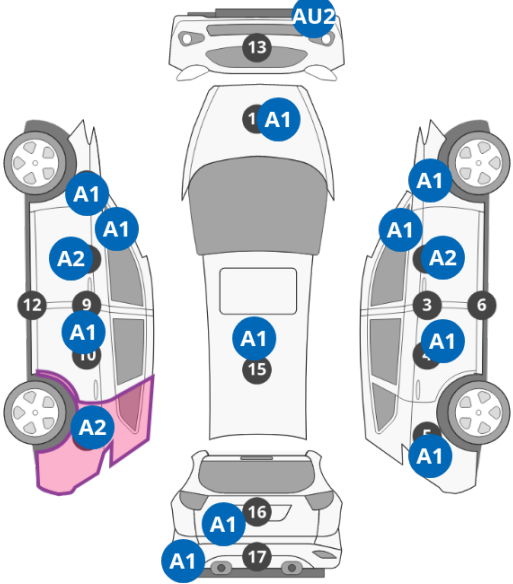
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	135.3	122	141	143
2	Boot Lid	94.5	87	98	99
3	Roof	89.7	88	86	93/92
4	Left Front Fender	104.6	107	107	100
5	Left Front Door	114.0	115	117	110
6	Center Panel Left				
7	Left Rear Door	108.6	118	109	99
8	Left Back Panel	106.3	110	108	101
9	Right Front Fender	93.6	93	93	95
10	Right Front Door	114.6	131	109	104
11	Center Panel Right				
12	Right Rear Door	101.0	96	101	106
13	Right Back Panel	93.7	101	89	91

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratches on tail light</p>