

General Information

Date & Time: 20, Nov, 2025 19:46

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	127,214
Registration No.	NET2203	Chassis No.	PA1B18F34M4150881
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



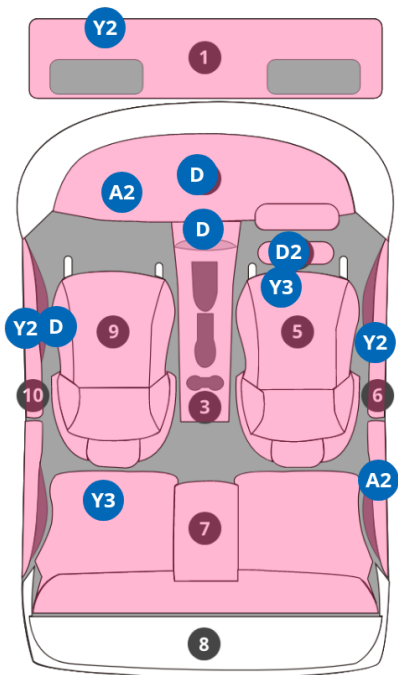
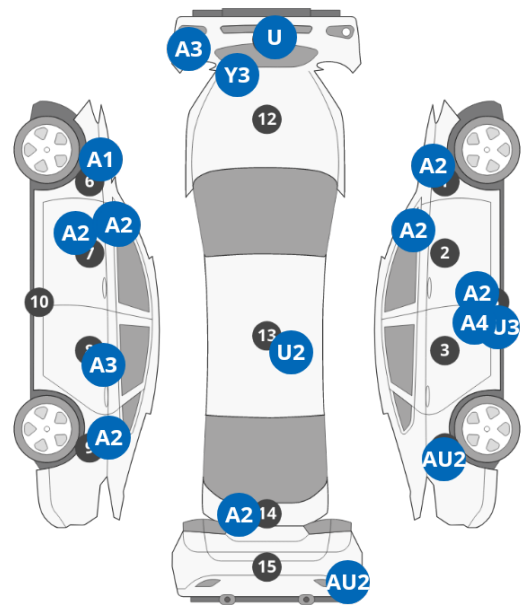
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	153.0	137	150	172
2	Boot Lid	104.1	99	101	112
3	Roof	141.5	144	136	140/146
4	Left Front Fender	90.0	83	96	91
5	Left Front Door	91.7	88	94	93
6	Center Panel Left				
7	Left Rear Door	134.3	136	135	132
8	Left Back Panel	147.0	160	133	148
9	Right Front Fender	96.5	96	100	93
10	Right Front Door	97.8	95	96	102
11	Center Panel Right				
12	Right Rear Door	99.2	102	98	98
13	Right Back Panel	102.0	103	98	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Cut, Crack - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Crack - Damaged / (L) Mirror - Scratch - Small / Bonnet, Headlight - Crack, Gap - Medium / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, possible flooding, scratches on tail light, left side mirror loose