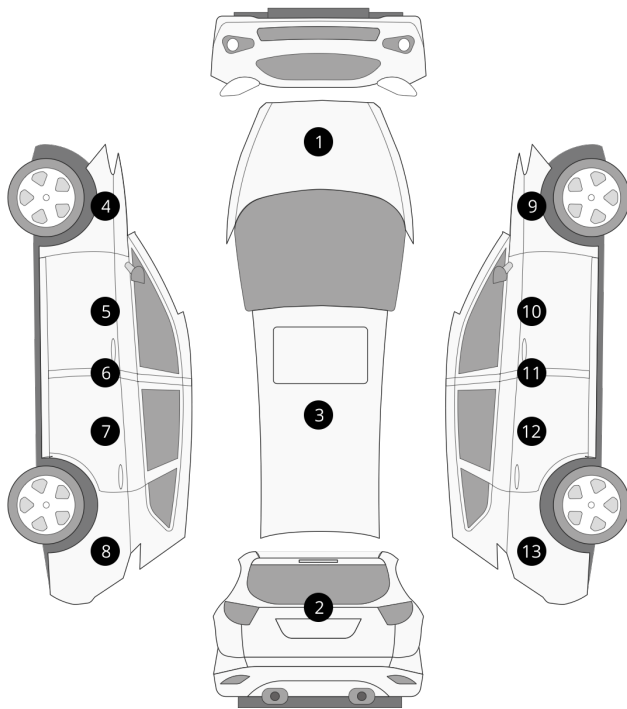


## General Information

Date & Time: 08, Nov, 2025 15:16

|                  |         |                   |                  |
|------------------|---------|-------------------|------------------|
| Make             | Suzuki  | Model             | Ertiga           |
| YOM              | 2024    | Odo Meter Reading | 13,340           |
| Registration No. | NOV1245 | Chassis No.       | MHYNC32S8RJ04168 |
| CC               | 1.5     | Transmission      | A/T              |
| Fuel Type        | Hybrid  | Type of Body      | Wagon            |
| Colour           | Gray    |                   |                  |

## Body / Panel Condition



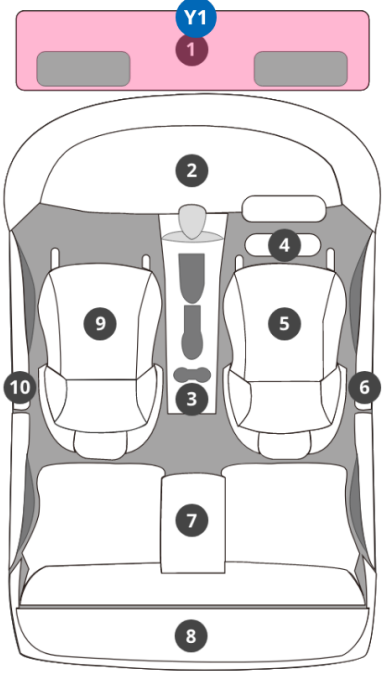
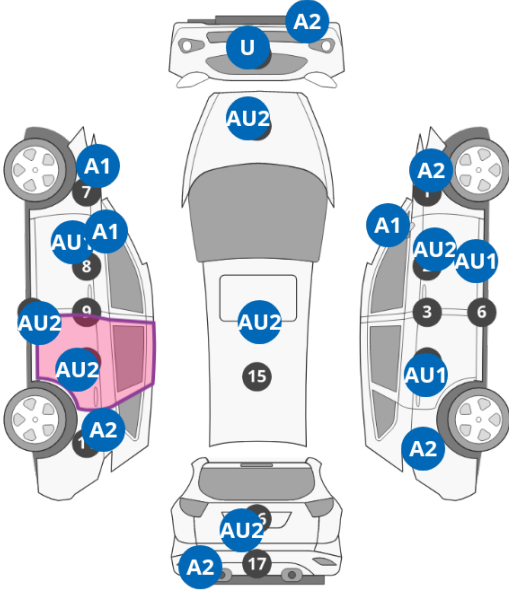
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 107.2         | 101    | 85     | 136      |
| 2  | Boot Lid           | 88.3          | 87     | 92     | 86       |
| 3  | Roof               | 85.1          | 84     | 81     | 88/88    |
| 4  | Left Front Fender  | 76.6          | 76     | 75     | 78       |
| 5  | Left Front Door    | 98.0          | 99     | 95     | 101      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 99.0          | 101    | 97     | 99       |
| 8  | Left Back Panel    | 81.5          | 83     | 86     | 75       |
| 9  | Right Front Fender | 74.2          | 73     | 80     | 70       |
| 10 | Right Front Door   | 100.0         | 102    | 98     | 100      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 105.1         | 100    | 97     | 118      |
| 13 | Right Back Panel   | 84.6          | 76     | 88     | 90       |

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

|                                                                                                                                                                                                                                                    |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Interior Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                 | <b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold;">C</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p> |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
| <b>Remarks</b><br>Ceiling - Grime - Minimal                                                                                                                                                                                                        | <b>Remarks</b><br>(R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small |
| <b>Frame Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                    | <b>Functional Evaluation :</b> <span style="color: red; font-weight: bold;">B</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                | <b>Remarks</b><br>Battery - Weak - Yes / Reverse Camera - N/A - Yes                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |

|                                                                                                                            |
|----------------------------------------------------------------------------------------------------------------------------|
| <b>Inspector Notes</b>                                                                                                     |
| With LTO plate and Sparetire, No warranty booklet and Tools and Jack, Scratch headlight and tail light, no reverse camera. |