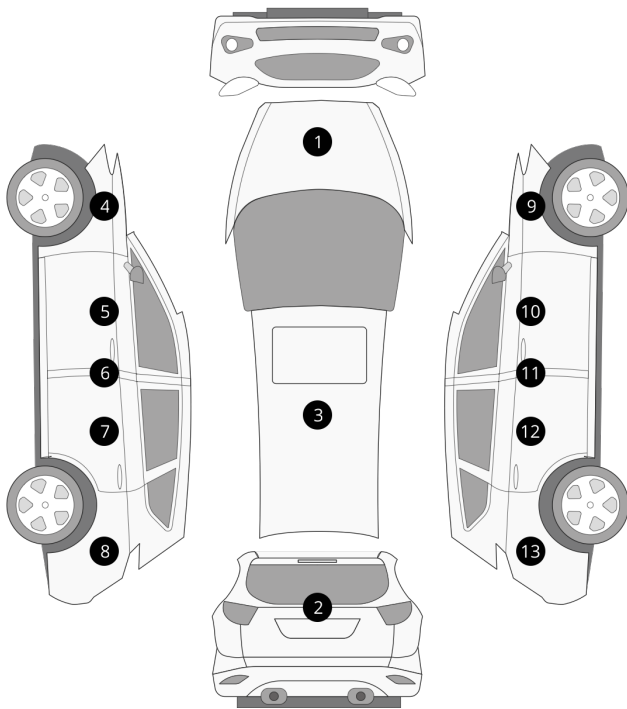


General Information

Date & Time: 12, Nov, 2025 12:38

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	29,038
Registration No.	CCG7928	Chassis No.	PAHACACA1S6421088
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



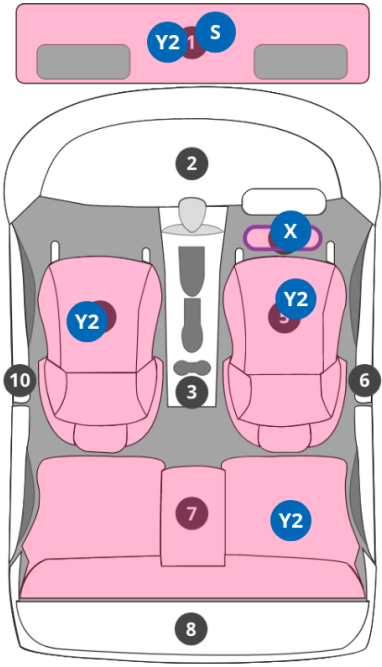
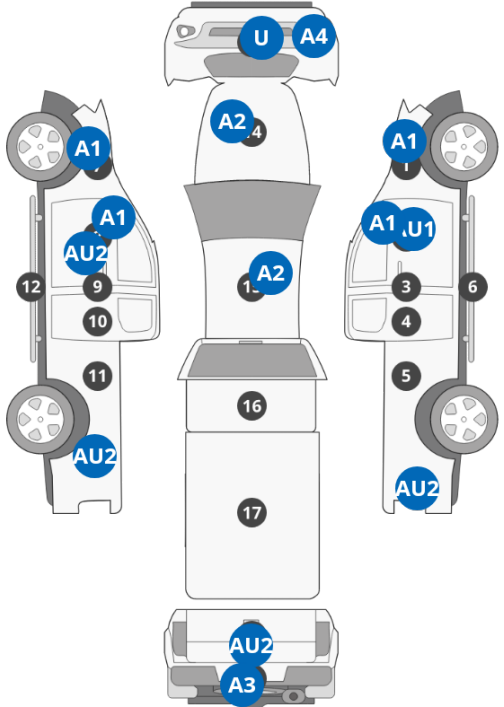
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	94.8	101	98	86
2	Boot Lid	47.3	50	44	48
3	Roof	115.0	109	122	110/119
4	Left Front Fender	101.8	108	98	99
5	Left Front Door	103.6	103	102	106
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	62.7	65	63	60
9	Right Front Fender	101.3	101	106	97
10	Right Front Door	99.0	94	98	105
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	59.1	57	55	65

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Mat Other - Missing - Yes / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small	Remarks Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Side Gate - Scratch & Dent - Small / Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Side Gate - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, no reverse camera, foul smell, worn tires and Sparetire, possible flooded, Room and plate light busted.