


General Information

Date & Time: 11, Nov, 2025 16:02

Make	Toyota	Model	Innova
YOM	2021	Odo Meter Reading	38,611
Registration No.	CBM1054	Chassis No.	PA2JA8EM4M0089220
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition

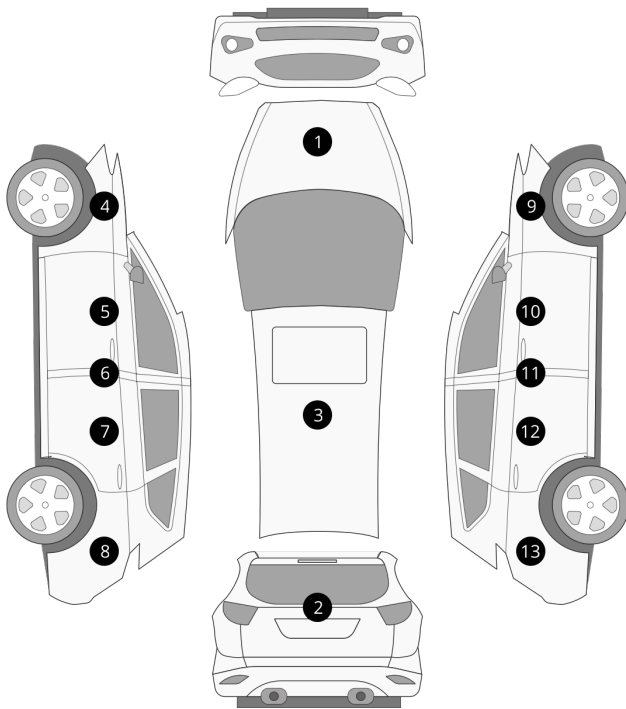

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.9	92	114	94
2	Boot Lid	108.0	103	110	111
3	Roof	99.9	99	97	111/92
4	Left Front Fender	96.0	102	99	87
5	Left Front Door	102.2	100	100	107
6	Center Panel Left				
7	Left Rear Door	104.7	111	105	98
8	Left Back Panel	185.3	209	163	184
9	Right Front Fender	97.8	95	101	97
10	Right Front Door	104.3	105	107	101
11	Center Panel Right				
12	Right Rear Door	96.6	89	98	103
13	Right Back Panel	108.6	107	113	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Small	Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate and Sparetire and Warranty booklet, No Tools and Jack, No Spare key, no reverse camera, foul smell, possible flooded, warning lamps on airbag, Scratch headlight and tail light, Plate and room light issue, headlight issue and foglight issue.