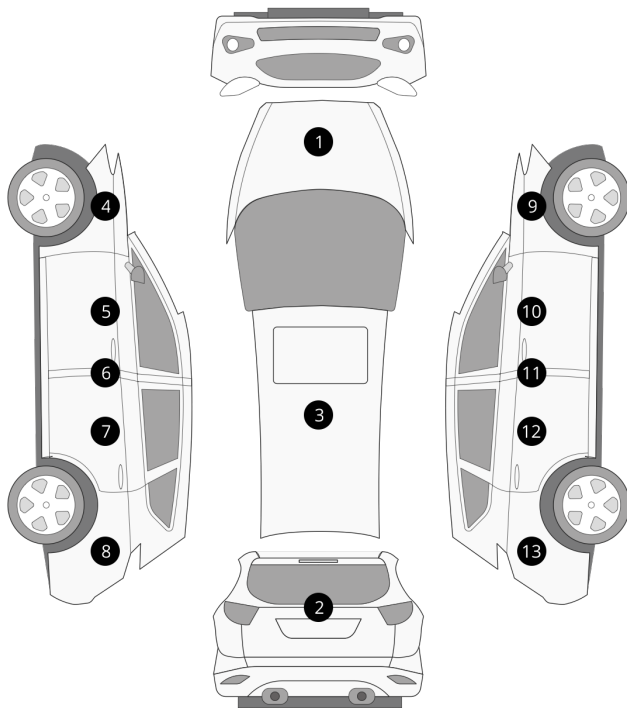


General Information

Date & Time: 10, Nov, 2025 13:56

Make	Toyota	Model	Rush
YOM	2024	Odo Meter Reading	42,513
Registration No.	NKD5183	Chassis No.	MHKE8FF3PRK060500
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



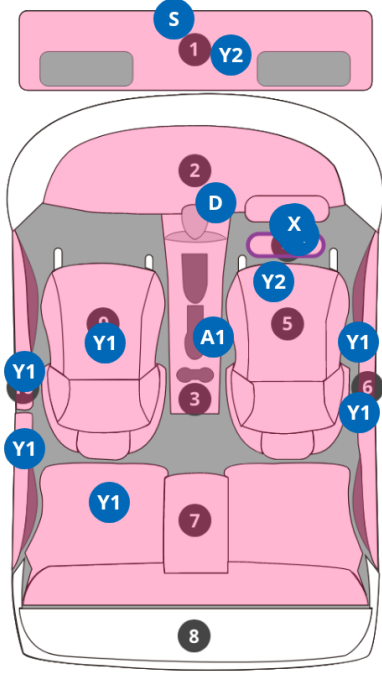
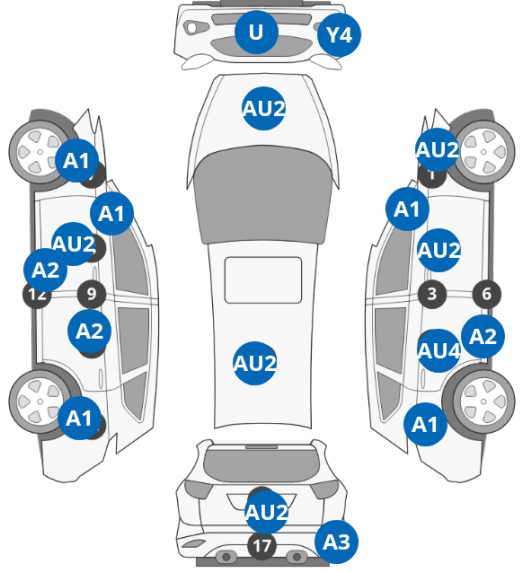
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.0	107	100	99
2	Boot Lid	102.9	104	109	96
3	Roof	96.7	87	89	100/111
4	Left Front Fender	106.3	109	102	108
5	Left Front Door	107.3	105	101	116
6	Center Panel Left				
7	Left Rear Door	115.3	126	111	109
8	Left Back Panel	102.0	110	107	89
9	Right Front Fender	98.6	101	97	98
10	Right Front Door	103.2	103	100	107
11	Center Panel Right				
12	Right Rear Door	96.5	96	91	102
13	Right Back Panel	96.3	94	97	98

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (R) Rear Trim - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Small / Rear Seat - Grime - Minimal / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Rear Door, Molding - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, scratch headlight and tail light, Worn Tires and Sparetire, No spare key, Abnormal vibration on engine, plate light issue, headlight issue.