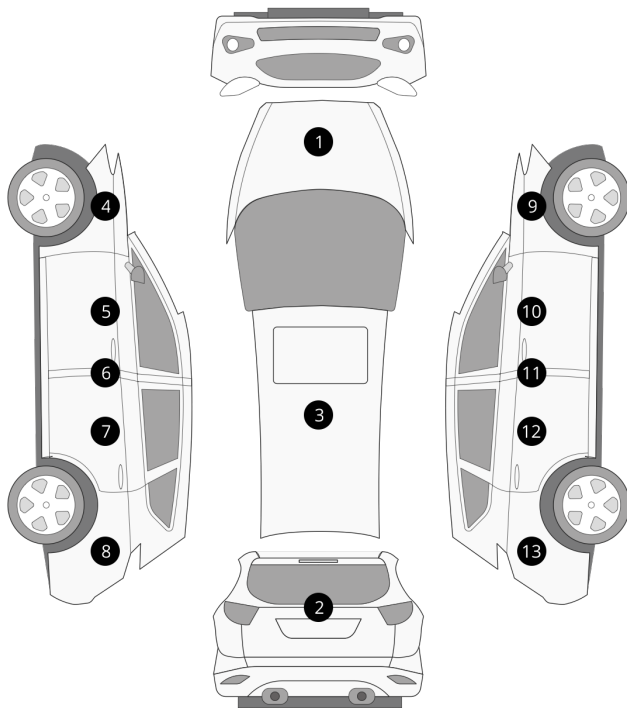


General Information

Date & Time: 11, Nov, 2025 16:03

Make	Toyota	Model	Rush
YOM	2023	Odo Meter Reading	103,529
Registration No.	BAC7917	Chassis No.	MHKE8FF3PNK048060
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	White		

Body / Panel Condition



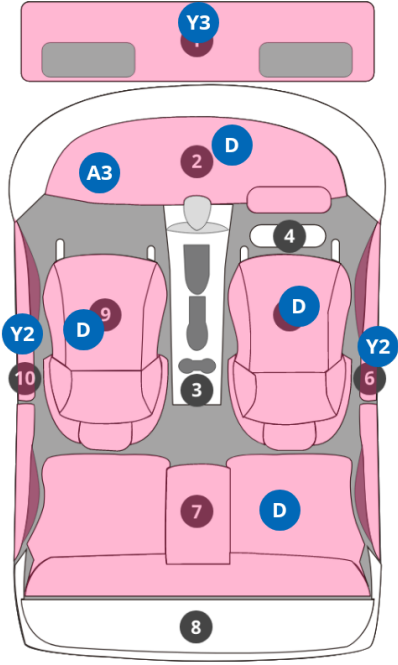
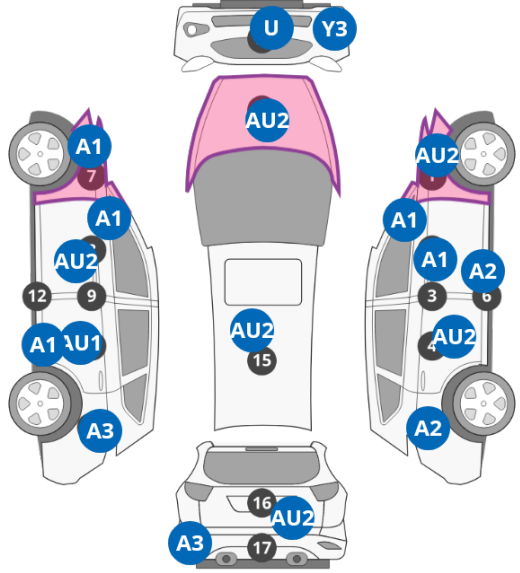
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.4	113	90	98
2	Boot Lid	105.0	99	117	99
3	Roof	92.8	85	83	98/106
4	Left Front Fender	97.9	100	98	96
5	Left Front Door	99.3	96	92	110
6	Center Panel Left				
7	Left Rear Door	104.0	112	99	101
8	Left Back Panel	96.5	106	94	90
9	Right Front Fender	101.0	100	101	102
10	Right Front Door	100.1	102	97	101
11	Center Panel Right				
12	Right Rear Door	100.5	95	99	107
13	Right Back Panel	96.5	90	98	102

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Worn - Yes	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Scratch & Dent - Small
Frame Evaluation : C	Functional Evaluation : A
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Spare tire, No Tools and Jack and Warranty booklet, No spare key, worn tires, adhesive marks on vehicle, busted foglight, scratch headlight and tail light, foul smell, possible flooded, plate light issue and headlight bulb issue and room light issue.