


General Information

Date & Time: 12, Nov, 2025 12:40

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	8,187
Registration No.	CCD2458	Chassis No.	PA1B18F31R4246829
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition

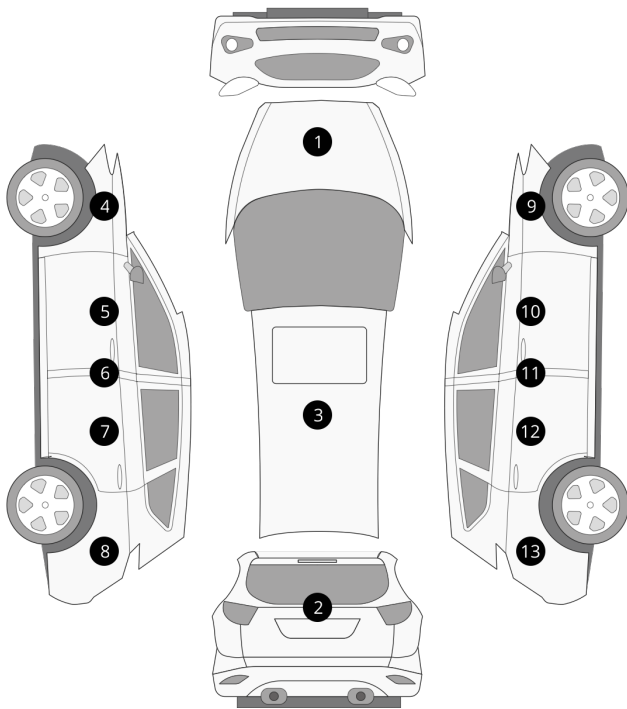

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	118	108	106
2	Boot Lid	109.0	103	113	111
3	Roof	94.2	93	100	89/95
4	Left Front Fender	91.9	93	93	90
5	Left Front Door	94.8	93	92	100
6	Center Panel Left				
7	Left Rear Door	104.5	113	104	97
8	Left Back Panel	103.6	104	104	103
9	Right Front Fender	92.3	94	94	90
10	Right Front Door	93.8	91	91	100
11	Center Panel Right				
12	Right Rear Door	100.4	96	98	108
13	Right Back Panel	98.6	98	97	101

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small / Mat Other - Crinkle - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small	Remarks (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With LTO plate, No warranty booklet and Spare tire and Jack and Tools, scratch headlight and tail light.