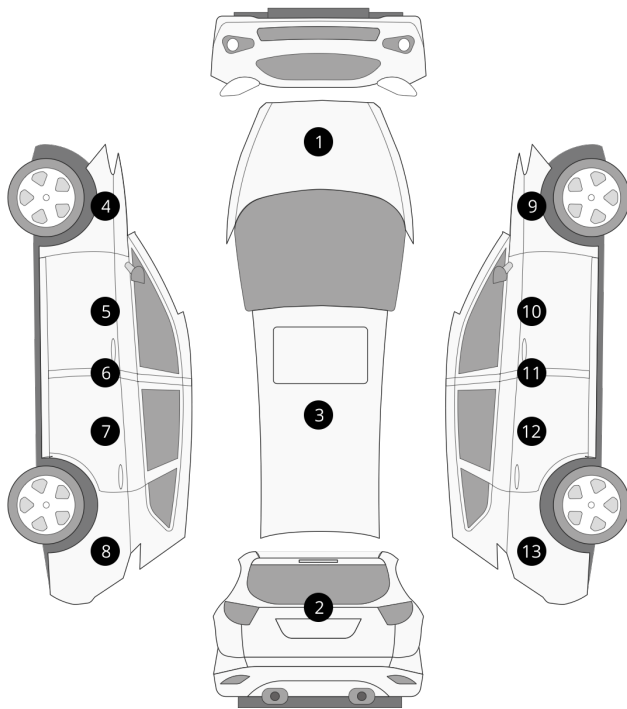


General Information

Date & Time: 12, Nov, 2025 12:41

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	19,867
Registration No.	CCA8171	Chassis No.	MHKAA1BC9RJ21215
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Red Mica Metallic		

Body / Panel Condition



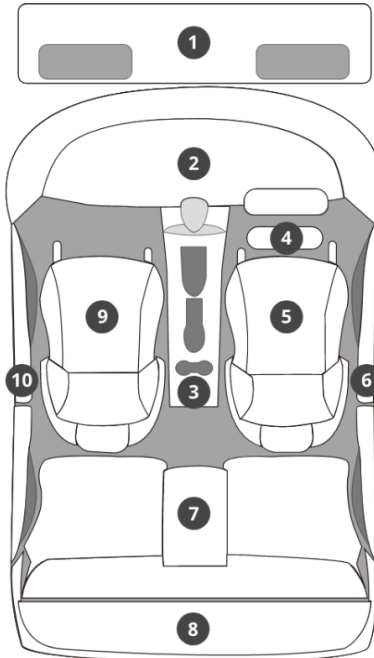
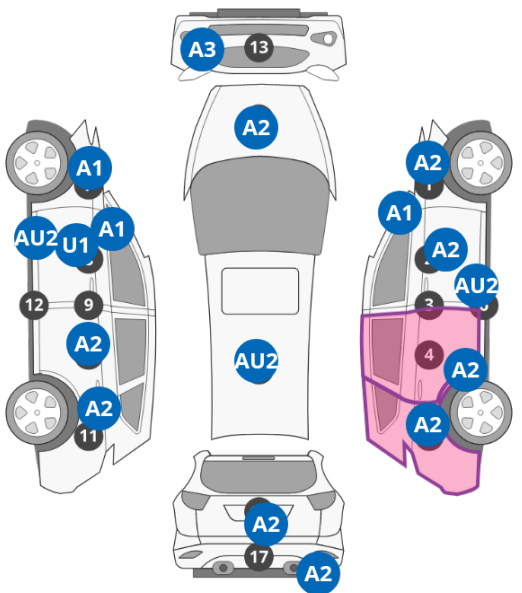
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.2	106	96	96
2	Boot Lid	82.2	81	86	80
3	Roof	74.9	74	81	72/72
4	Left Front Fender	81.7	81	83	81
5	Left Front Door	99.9	100	99	101
6	Center Panel Left				
7	Left Rear Door	89.8	99	93	78
8	Left Back Panel	76.6	75	70	85
9	Right Front Fender	82.8	86	81	82
10	Right Front Door	108.3	117	104	104
11	Center Panel Right				
12	Right Rear Door	97.0	90	93	108
13	Right Back Panel	88.2	88	85	92

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, worn tires and Sparetire, Scratch headlight and tail light.