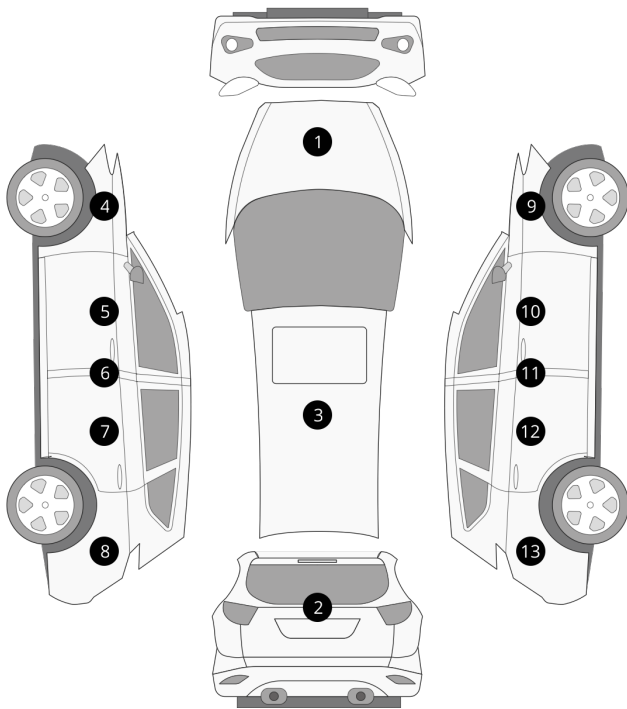


General Information

Date & Time: 12, Nov, 2025 12:42

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	34,214
Registration No.	CCF6918	Chassis No.	PA1B18F39R4264978
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



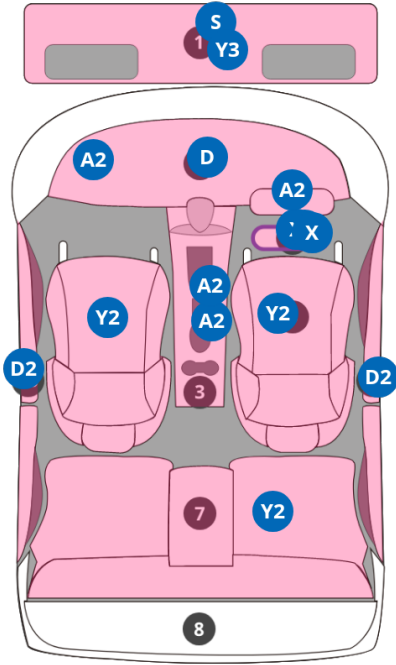
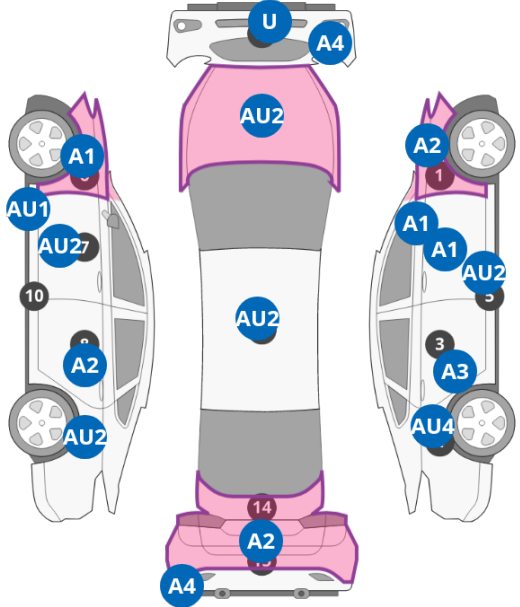
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	107	116	113
2	Boot Lid	175.3	171	165	190
3	Roof	105.7	125	95	108/95
4	Left Front Fender	93.3	94	93	93
5	Left Front Door	101.3	97	104	103
6	Center Panel Left				
7	Left Rear Door	99.3	101	100	97
8	Left Back Panel	105.0	103	112	100
9	Right Front Fender	95.8	91	100	96
10	Right Front Door	97.8	96	101	97
11	Center Panel Right				
12	Right Rear Door	99.7	99	99	101
13	Right Back Panel	101.3	94	90	120

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Overall Interior - Smell - Yes / Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Knobs - Worn, Peel, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small / Glove Box - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Shift Shock - Function - Weak / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, scratch headlight and tail light, damage tail light, no spare key, no reverse camera, foul smell, possible flooded ,worn tires and Sparetire, plate and room light issue, headlight issue and tail light issue.