

General Information

Date & Time: 12, Nov, 2025 13:34

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	13,256
Registration No.	CCG8741	Chassis No.	PA1B18F37S4287486
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



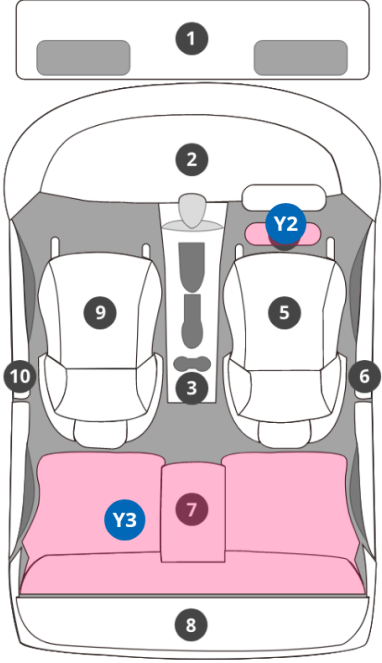
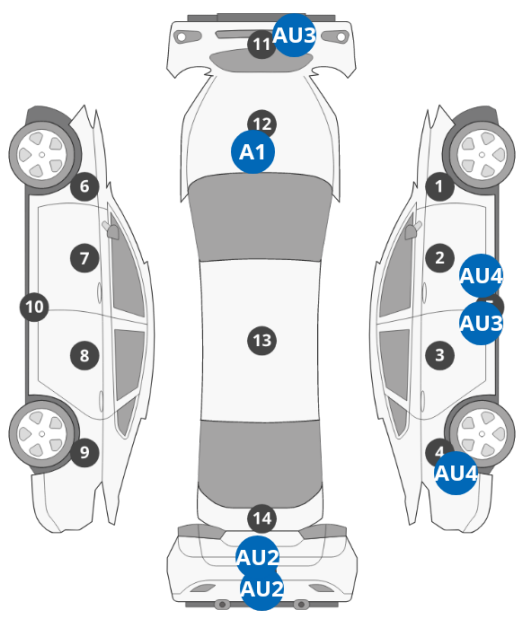
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	122	119	107
2	Boot Lid	115.0	111	114	120
3	Roof	103.4	109	99	105/101
4	Left Front Fender	104.3	103	104	106
5	Left Front Door	100.4	103	97	101
6	Center Panel Left				
7	Left Rear Door	108.0	118	104	102
8	Left Back Panel	117.6	124	119	110
9	Right Front Fender	110.0	104	109	117
10	Right Front Door	106.6	119	101	100
11	Center Panel Right				
12	Right Rear Door	112.6	103	106	129
13	Right Back Panel	105.3	105	103	108

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (L) Front Floor Mat - Grime - Small	Remarks (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with warranty booklet, with spare tire, with jack and tools, 1key,