

General Information

Date & Time: 13, Nov, 2025 15:46

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	5,214
Registration No.	CCR4063	Chassis No.	MHFAA1BYY8S00412697
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



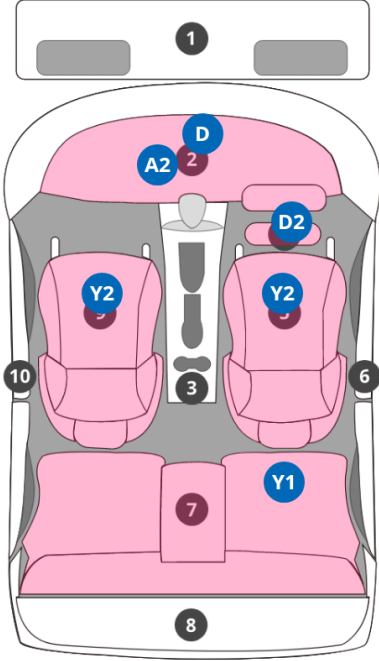
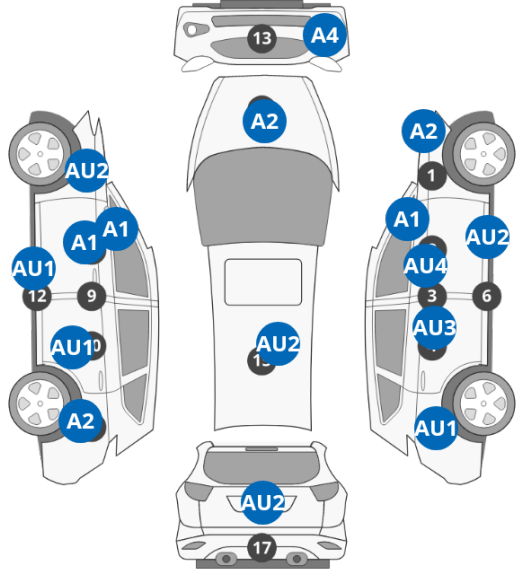
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.3	100	101	112
2	Boot Lid	99.0	94	107	96
3	Roof	110.7	116	109	117/101
4	Left Front Fender	98.6	99	98	99
5	Left Front Door	111.6	101	115	119
6	Center Panel Left				
7	Left Rear Door	111.6	109	112	114
8	Left Back Panel	109.4	117	113	98
9	Right Front Fender	94.3	93	101	89
10	Right Front Door	108.3	114	107	104
11	Center Panel Right				
12	Right Rear Door	102.8	105	97	106
13	Right Back Panel	104.2	95	105	113

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Minimal	Remarks (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With LTO plate, Sparetire, No Tools and Jack and Warranty booklet, scratch headlight and tail light.