


General Information

Date & Time: 10, Nov, 2025 17:03

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	10,943
Registration No.	CCR4255	Chassis No.	MHFAA1BY0S0043075
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Red		

Body / Panel Condition

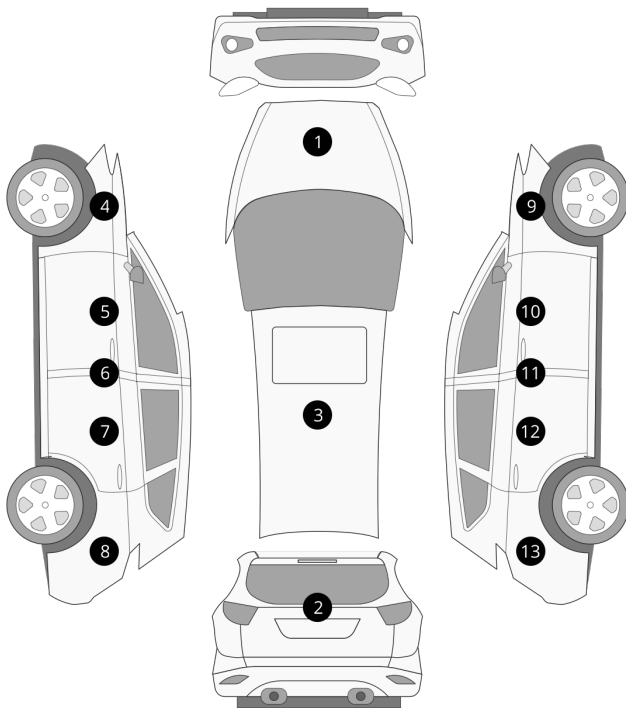

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	108	108	108
2	Boot Lid	100.8	99	105	99
3	Roof	111.7	118	110	117/102
4	Left Front Fender	93.7	95	89	97
5	Left Front Door	116.0	110	112	126
6	Center Panel Left				
7	Left Rear Door	111.6	116	105	114
8	Left Back Panel	106.3	118	107	94
9	Right Front Fender	95.9	95	98	94
10	Right Front Door	110.0	115	110	105
11	Center Panel Right				
12	Right Rear Door	107.6	112	102	109
13	Right Back Panel	105.8	98	105	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : Remarks (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Rear Seat - Grime - Small	Exterior Evaluation : Remarks Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / (R) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : Remarks Defects not found	Functional Evaluation : Remarks Spare Key - Issue - Unexist

Inspector Notes

With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, worn tires, foul smell, scratch and crack tail light and headlight.