


General Information

Date & Time: 12, Nov, 2025 14:47

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	24,188
Registration No.	DBF9979	Chassis No.	PA1B18F30R4255487
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition

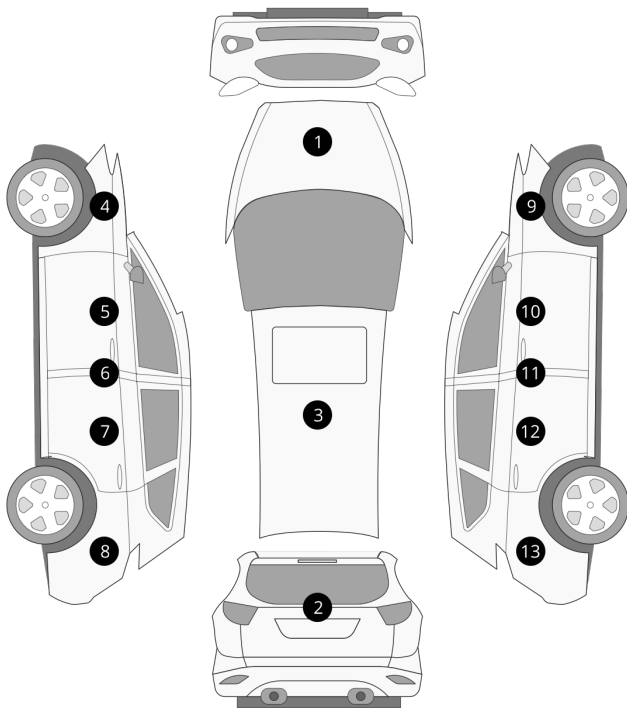


#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.3	113	102	116
2	Boot Lid	115.0	112	120	113
3	Roof	100.5	106	98	99/100
4	Left Front Fender	98.9	97	98	102
5	Left Front Door	108.0	103	100	121
6	Center Panel Left				
7	Left Rear Door	236.3	220	307	182
8	Left Back Panel	108.3	114	110	101
9	Right Front Fender	103.6	104	101	106
10	Right Front Door	109.0	103	116	108
11	Center Panel Right				
12	Right Rear Door	115.6	115	113	119
13	Right Back Panel	113.3	116	109	115

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

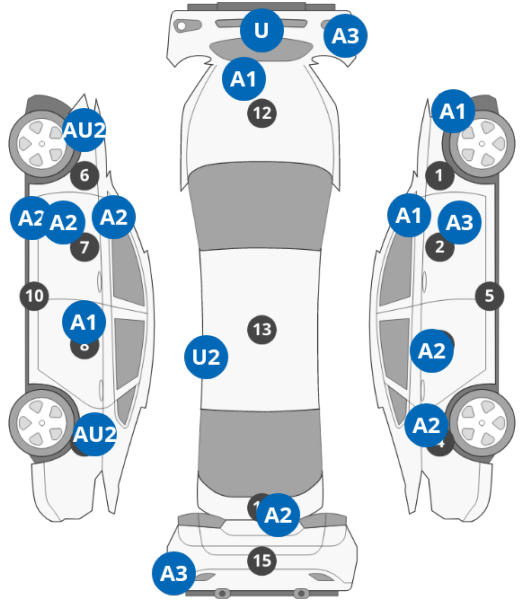Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal	Remarks (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light