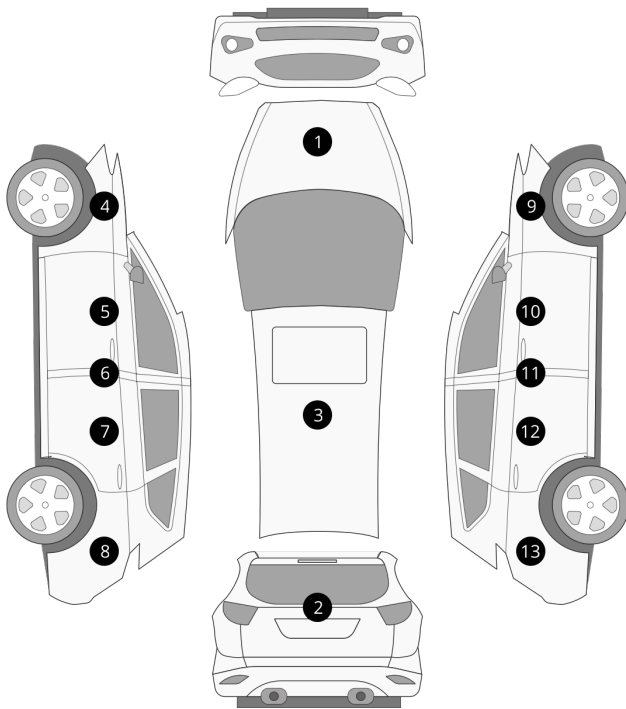


General Information

Date & Time: 12, Nov, 2025 13:12

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	24,962
Registration No.	NEY7236	Chassis No.	PA1B18F39R4263247
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



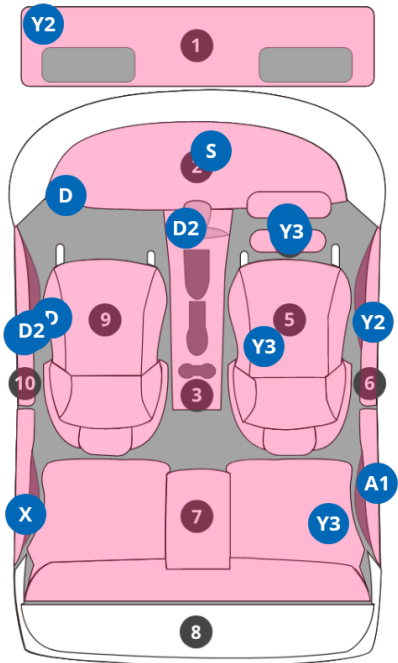
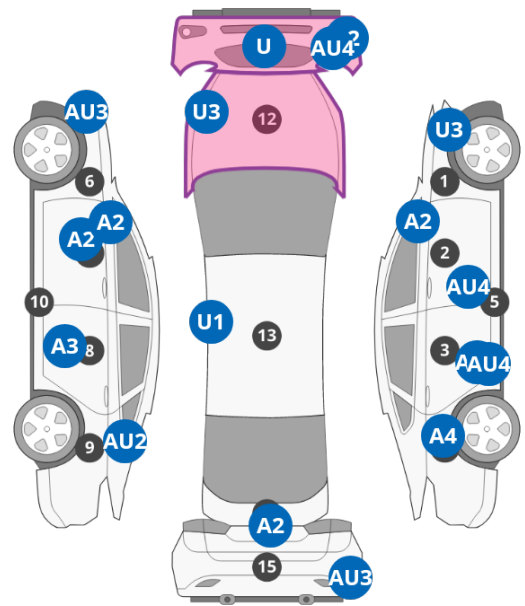
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	119	113	121
2	Boot Lid	121.0	127	115	121
3	Roof	114.7	120	107	113/119
4	Left Front Fender	99.8	98	103	98
5	Left Front Door	102.1	102	106	99
6	Center Panel Left				
7	Left Rear Door	119.3	106	97	155
8	Left Back Panel	106.0	112	104	102
9	Right Front Fender	108.6	97	114	115
10	Right Front Door	111.6	114	115	106
11	Center Panel Right				
12	Right Rear Door	105.5	100	107	110
13	Right Back Panel	113.6	104	113	124

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Rear Trim - Cut, Crack - Minimal / Trim Other - Missing - Yes / (L) Front Trim - Grime - Medium / (L) Front Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Cut, Crack - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Medium / Overall Interior - Smell - Yes / Console, Switches, Vents - Loose, Deformed - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Dent - Medium / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Modified - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack, no tools, no spare tire, with LTO plate, scratched and cracked tail light, reverse and plate light issue, headlight low beam issue, turn signal/hazard flasher issue, brake issue, traction control indicator ON, dome light issue, steering wheel issue, loose trunk hood and right side mirror