

General Information

Date & Time: 12, Nov, 2025 12:59

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	72,692
Registration No.	NHI2738	Chassis No.	PA1B18F32P4204571
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



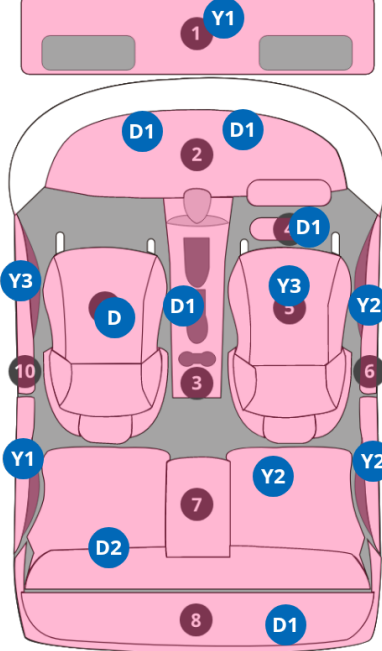
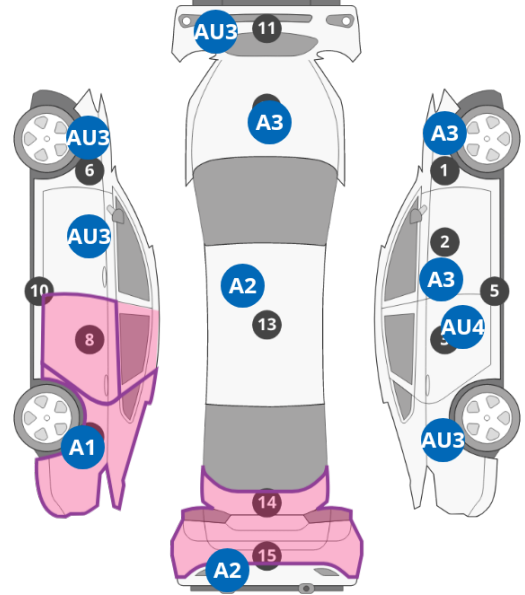
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.3	100	94	101
2	Boot Lid	191.6	150	229	196
3	Roof	97.6	103	93	100/95
4	Left Front Fender	99.3	98	100	100
5	Left Front Door	100.2	100	98	103
6	Center Panel Left				
7	Left Rear Door	150.6	157	150	145
8	Left Back Panel	109.3	111	108	109
9	Right Front Fender	100.5	98	103	101
10	Right Front Door	96.9	98	96	97
11	Center Panel Right				
12	Right Rear Door	105.5	95	116	106
13	Right Back Panel	110.6	99	95	139

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / Carpet - Worked - Minimal / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / Console, Switchs, Vents - Worked - Minimal / Glove Box - Worked - Minimal / Dashboard - Worked - Minimal / Rear Seat - Grime - Small / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Medium / Rear Seat Head Rest - Worked - Small / Trunk Room - Worked - Minimal / Ceiling - Grime - Minimal	Remarks (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Repair mark - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Roof - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch - Medium
Frame Evaluation : D	Functional Evaluation : B
Remarks Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Center Pillar - Condition of Welding ? - Yes	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with manual & warranty booklet, with spare key, with incomplete tools & jack, with spare tire, broken taillight left side, no reverse camera.