

General Information

Date & Time: 12, Nov, 2025 12:36

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	44,419
Registration No.	NIM8225	Chassis No.	PA1B18F36P4210115
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



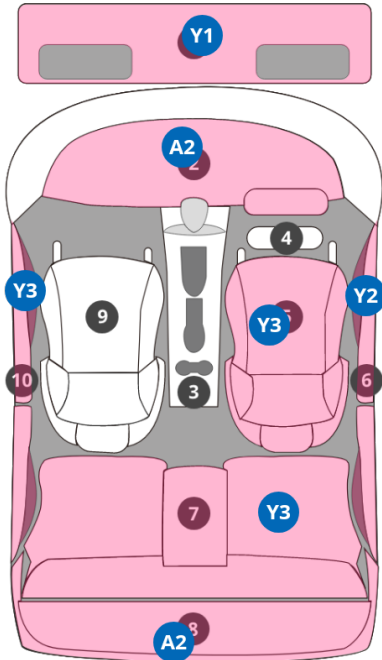
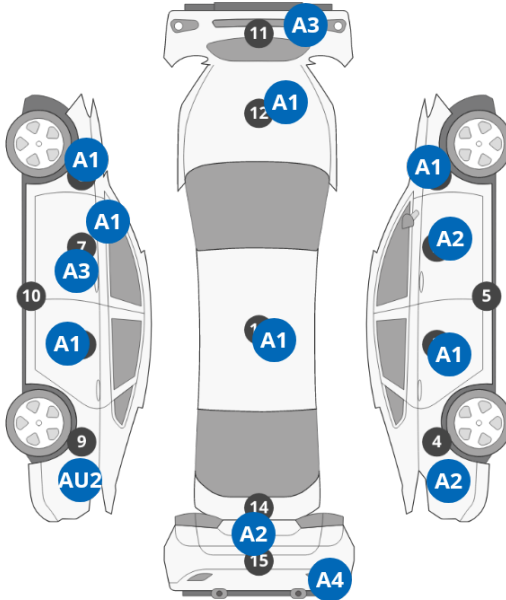
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	120	100	117
2	Boot Lid	110.6	103	110	119
3	Roof	94.9	97	92	90/101
4	Left Front Fender	98.5	99	99	98
5	Left Front Door	99.5	99	104	96
6	Center Panel Left				
7	Left Rear Door	100.0	101	102	97
8	Left Back Panel	108.6	114	104	108
9	Right Front Fender	106.6	111	105	104
10	Right Front Door	107.1	98	108	115
11	Center Panel Right				
12	Right Rear Door	106.1	99	109	111
13	Right Back Panel	102.3	99	100	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C		Exterior Evaluation : C	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Minimal		Remarks Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : B	
Remarks Defects not found		Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist	

Inspector Notes

with LTO plate/with spare tire/No spare key/reverse camera not working/with jack / No tools/No warranty booklet/front right side mirror issue