

General Information

Date & Time: 10, Jan, 2025 15:43

Make	Toyota	Model	Vios
YOM	2021	Mileage	57,432
Registration No.	DAU3414	Chassis No.	PA1B18F31M4134945
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



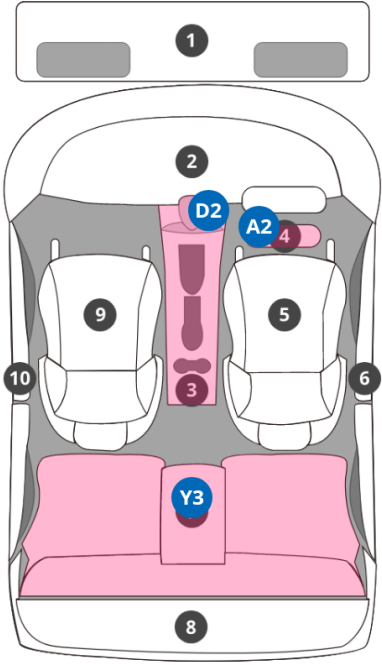
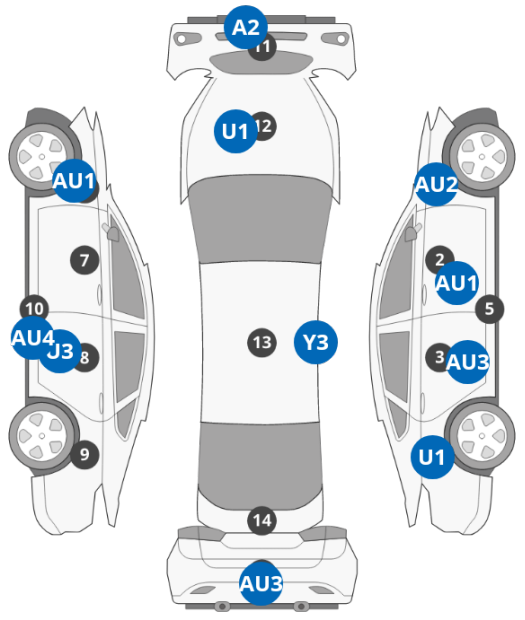
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.0	138	124	107
2	Boot Lid	137.6	138	143	132
3	Roof	191.0	194	190	192/188
4	Left Front Fender	134.0	134	141	127
5	Left Front Door	153.3	166	153	141
6	Center Panel Left				
7	Left Rear Door	161.3	168	159	157
8	Left Back Panel	139.6	143	144	132
9	Right Front Fender	338.0	319	360	335
10	Right Front Door	118.6	122	111	123
11	Center Panel Right				
12	Right Rear Door	126.6	113	122	145
13	Right Back Panel	168.0	149	163	192

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Cut, Crack - Small / Rear Seat - Grime - Medium / Console, Switchs, Vents - Loose, Deformed - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Roof - Crack, Gap - Medium / (L) Rear Door, Molding - Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, incomplete tools.