

General Information

Date & Time: 13, Nov, 2025 15:43

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	62,105
Registration No.	NEY4101	Chassis No.	PA1B18F3XR4259964
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



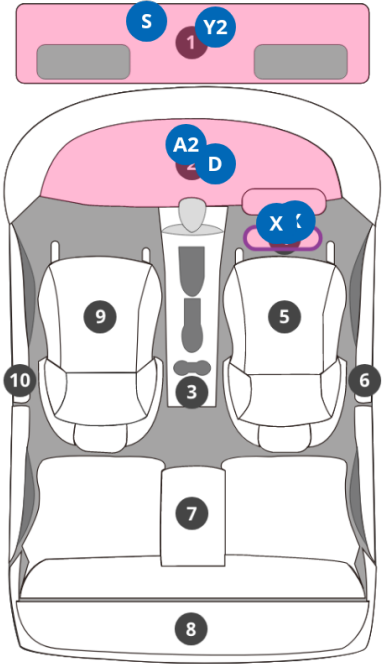
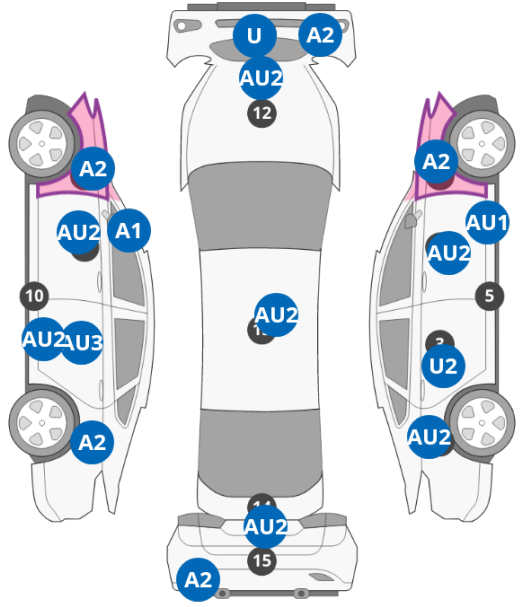
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	125	118	113
2	Boot Lid	112.0	111	105	120
3	Roof	100.2	107	100	101/93
4	Left Front Fender	101.8	110	97	99
5	Left Front Door	104.0	104	107	101
6	Center Panel Left				
7	Left Rear Door	106.6	105	105	110
8	Left Back Panel	107.6	114	102	107
9	Right Front Fender	94.2	92	94	98
10	Right Front Door	91.3	89	90	95
11	Center Panel Right				
12	Right Rear Door	95.9	89	96	103
13	Right Back Panel	101.8	98	101	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, worn tires and Sparetire, Scratch headlight and tail light, not moving vehicle, plate and room light issue, headlight issue, warning lamps on.