

General Information

Date & Time: 12, Nov, 2025 10:27

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	52,312
Registration No.	NKF3018	Chassis No.	MHFAA1BY7R0031273
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



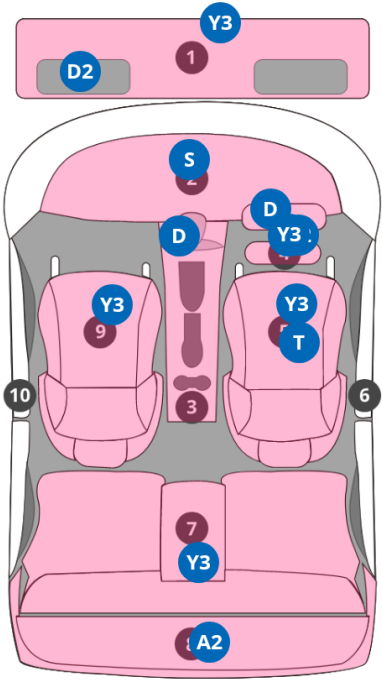
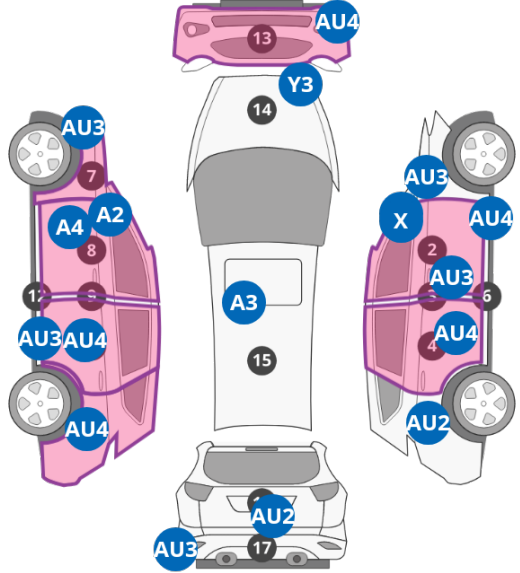
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.1	83	135	130
2	Boot Lid	88.5	89	80	97
3	Roof	120.3	145	138	120/79
4	Left Front Fender	92.7	83	88	107
5	Left Front Door	110.8	132	106	95
6	Center Panel Left				
7	Left Rear Door	106.9	143	90	88
8	Left Back Panel	110.7	85	102	145
9	Right Front Fender	87.3	89	89	84
10	Right Front Door	107.0	114	104	103
11	Center Panel Right				
12	Right Rear Door	95.8	111	86	91
13	Right Back Panel	112.5	98	117	123

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Cigarette Burns - Burnt, Hole / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Medium / Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / Mat Other - Grime - Medium / Sunvisor, Sunglass Holder - Crinkle - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Medium / (R) Mirror - Stuck - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Crack, Gap - Medium / Roof - Scratch - Medium / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Head Light, High Beam - Issue - Yes

Inspector Notes
no warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on headlight and tail, cracked tail light, possible flooding, right side mirror issue and partially missing, check engine warning lamp and traction control indicator ON, rear door lock issue, adhesive mark on left and right air vents