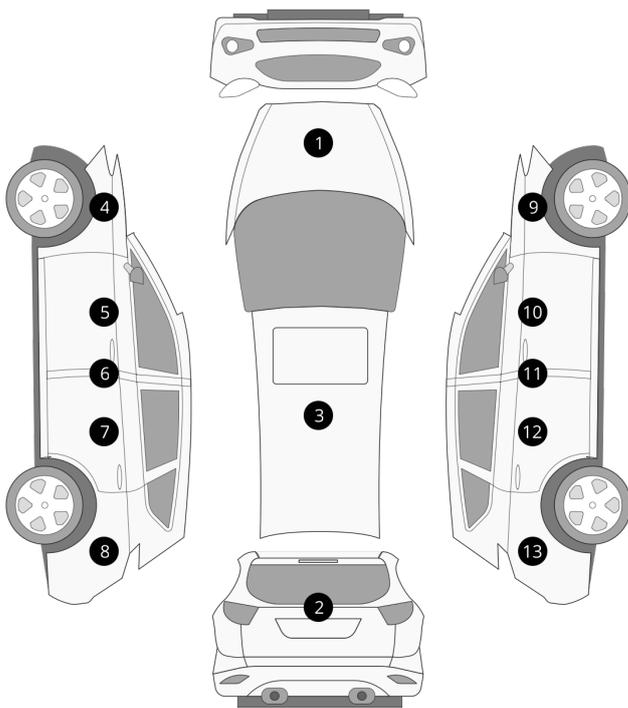


General Information

Date & Time: 14, Nov, 2025 08:24

Make	Toyota	Model	Wigo
YOM	2018	Odo Meter Reading	75,737
Registration No.	MAO4199	Chassis No.	MHKA4DF5FJJ018900
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Black		

Body / Panel Condition



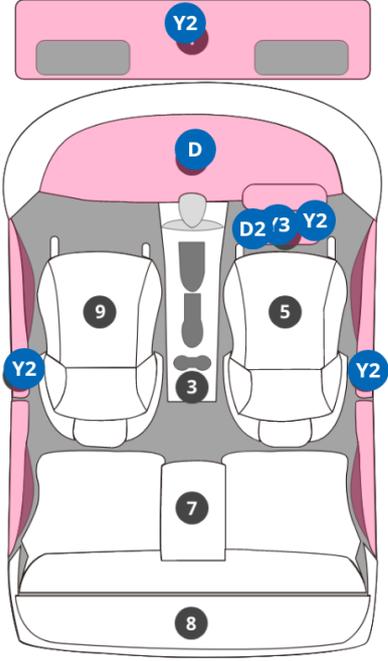
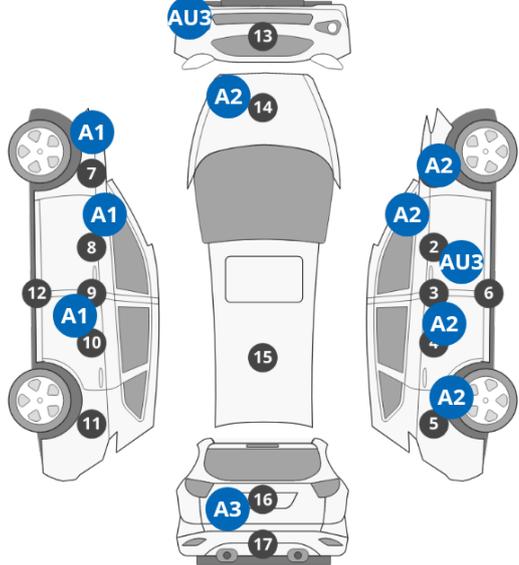
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	162.3	161	169	157
2	Boot Lid	162.0	147	195	144
3	Roof	135.5	128	117	148/149
4	Left Front Fender	222.0	220	217	229
5	Left Front Door	164.6	174	153	167
6	Center Panel Left				
7	Left Rear Door	245.6	240	245	252
8	Left Back Panel	150.0	156	143	151
9	Right Front Fender	166.0	170	155	173
10	Right Front Door	158.6	182	141	153
11	Center Panel Right				
12	Right Rear Door	144.0	143	142	147
13	Right Back Panel	204.0	242	185	185

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / Mat Other - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Check engine light. Transmission warning lamp. shift shock issue when reverse. Trunk floor missing. Without warranty booklet, spare tire, jack and tools. With leather seat cover. 1 key. With LTO plate. Mags without tire.</p>